

	- Model	
SERIAL NUMBER (LEFT):	2 <u>8</u> 023	e Number
SERIAL NUMBER (RIGHT):	23024	Sorial
DATE OF MANUFACTURE:	9-98	

ATE 9	TOTAL TIME IN	Current Weight and Balance Information				
	SERVICE	Empty Weight	Empty C.G.	Useful Load	Remarks	
	DATE: 10-14	-98 N66003 TACH	I TIME: 628.5			
	23024, ON		SERIAL NUMBI		NUMBER 23023 AND ACCORDANCE WITH	
	CURRENT R APPROVED THIS REPAIR SIGNED	ABOVE WAS REGULATIONS OF	EPAIRED AND THE FEDERAL SERVICE. PERT. R W/O NO. 6 2	INSPECTED IN AVIATION ADMINENT OF THE RE	LER, OR APPLIANCE ACCORDANCE WITH INISTRATION AND IS EPAIR ARE ON FILE AT 10-14-98	

TE	TOTAL	Current Weig	ht and Balance Information	n .
Su	09/1 c.@wy	sine -	6-3-01  Both Nose Weels  Discosinbled, cleaned, repaled beamp, new types + trues	B-297-01 Both nose wheels- Replaced Swivel bloch Assy 21A 06 - bboch Assy 21A 06001 -> -003
- u	of year		6-3-0  Rt Man Bates intel Disassembled. republic Bearny, replaced seals	Both nose when
				due to 1 shimmy.

DATE 19	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Altera Entries must be endorsed with Name, Rating and Certificate Numb Technician or Repair Facility. (See back pages for other specific en	ation Der of Intries.
	RIGGE WITH BIMBA	D WATER NEW. UR	R RUDDER : PDATED NO ATING CYI	N66003 TACH TIME: 631.0  RETRACT CABLE. REPLACED BOTH AFTER BODY KEELS DSE WHEEL AXLES AND REPLACED BOTH NOSE GEAR LINDERS. UPDATED WATER RUDDERS, STOPS, AND	
	NUMB SERVI UPDA' EMER	ER 55 A1 CE LETT IED BA0 GENCE H	ND INSTALI ER NUMBE GGAGE CO AND PUMP	ANDING GEAR BY COMPLYING WITH SERVICE LETTER LING SERVICE KIT NUMBER 34 IN ACCORDANCE WITH LR 52. REPLACED BILGE LINE BRACKETS AS REQUIRED. OMPARTMENT BILGE PUMP OUT SYSTEM. UPDATED SELECTOR. LEAK CHECKED FLOATS, OK.	
	IDENT CURR APPROTHIS	TIFIED A ENT REC OVED FO	BOVE WAS SULATIONS R RETURN T TATION UN	ME, AIRCRAFT ENGINE, PROPELLER, OR APPLIANCE S REPAIRED AND INSPECTED IN ACCORDANCE WITH OF THE FEDERAL AVIATION ADMINISTRATION AND IS TO SERVICE. PERTINENT OF THE REPAIR ARE ON FILE AT DER DATE 2-20-2003	
	SIGN	ED (	James		

DATE 19	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alteration Entries must be endorsed with Name, Rating and Certificate Number Technician or Repair Facility. (See back pages for other specific entries)	of
	BOOSTERS, IP PAINTED AS NECESSARY. GASKETS AS ASSEMBLY. I WIPLINE SE ACCUMULAT SATISFACTOR THE AIRCRAI WAS REPAIR EFDERAL AS	WITH WIPS BY INSTAL S ORIGINA CLEANEI NECESSA RE-INSTAL RVICE LE TOR HOSE, RY. FT AIRFRA LED AND VIATION OF THE REI 18	LINE SERVICE LATION OF KAL. WATER O SEALING A RY. PAINTED LED DRAG LI ETTER 48, B RE-SEATED  AME, AIRCRAI INSPECTED II ADMINISTRA PAIR ARE ON	THE LETTER 51, INSTALLATION OF FOAM FILLED FLOAT KIT 33. STRIPPED BOTTOMS OF BOTH FLOAT MAIN KEELS. CHECKED BOTH HULLS. SEALED MINOR LEAKS AS REA OF ALL FLOAT TOP DECK COVERS AND REPLACED BOTH WATER RUDDER POSTS. REMOVED R/H MAIN GEAR INK BUSHINGS AND RE-INSTALLED GEAR. COMPLIED WITH BY INSTALLATION OF KIT 32, ADDITION OF SYSTEM DRAG LINK BUSHING. LANDING GEAR RETRACTION TEST  FIT ENGINE, PROPELLER, OR APPLIANCE IDENTIFIED ABOVE IN ACCORDANCE WITH CURRENT REGULATIONS OF THE TION AND IS APPROVED FOR RETURN TO SERVICE.  THE ACT OF THE SEPAIR STATION UNDER ACCORDANCE WITH CURRENT REGULATIONS OF THE TION AND IS APPROVED FOR RETURN TO SERVICE.  THE ACT OF THE SEPAIR STATION UNDER ACCORDANCE WITH CURRENT REGULATIONS OF THE TION AND IS APPROVED FOR RETURN TO SERVICE.	

ATE 9	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
-9-0	TAC	JA		Complied with Wipline Service Letter #66 by installation of Service Kit #48 to
				Solve nose wheel shinny problems.  Adjusted as needed. Ops Vole.  Cuthlibra 387527086 6-9-05
REG# MAKE MODEL S/N	N6600 CESSNA 172XF R172300	A	LAKESH	
NOSE GEA	LED A 5.00-5 ( AR HYDRAULIC A MY TROUS	CTUATOR	EADED MAIN TI	(920)-682-0043  IRE ON LEFT FLOAT. ROTATED MAIN TIRE ON RIGHT FLOAT. INSTALLED A NEW  1 IN RIGHT FLOAT. CYCLED GEAR 20 TIMES, AND SERVICED HYDRAULIC RESERVOIR.  A&P 391849627
REG# MAKE MODEL S/N	N6600 CESSN R172K2 R17230	A XP	LAKESI	LAKESHORE AVIATION  MANITOWOC COUNTY AIRPORT  1815 FREEDOM WAY  MANITOWOC, WI 54220  (920)-682-0043
ALC: UNI				PECTED IAW AN ANNUAL INSPECTION AND WERE DETERMINED TO BE AIRWORTHY.

© 1991 ASA

REG# MAKE MODEL S/N

THESE FL JEREN

ROTAT

REG# MAKE MODEL SERIAL#

I CERTIFY BE AIRWORT

JEREM'

REG# MAKE MODEL S/N

THESE FL

**JEREMY** 

REG#	N66003	
MAKE	CESSNA	
MODEL	R172KXP	
S/N	R1723000	1



DATE	9/4/2009
TACH	2257
nd Cert	THE RESERVE OF
for extra	

ROTATED LEFT MAIN TIRE. INSTALLED NEW BEARINGS P/N 08125 AND RACES P/N 08231 IN LEFT MAIN WHEEL. I CERTIFY THAT THESE FLOATS HAVE BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND WERE DETERMINED TO BE AIRWORTHY.

JEREMY TROUSIL



A&P 391849627 IA

REG#	N66003	
MAKE	CESSNA	1
MODEL	R172K	
SERIAL#	R1723000	-

 


LAKESHORE AVIATION
MANITOWOC COUNTY AIRPORT
1815 FREEDOM WAY
MANITOWOC, WI 54220
(920)-682-0043

DATE	10/1/2010
TACH	2361
12.000.42	
4	

I CERTIFY THAT THESE FLOATS HAVE BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND WERE DETERMINED TO BE AIRWORTHY.

JEREMY TROUSIL



A&P 391849627 IA

REG#	N66003	700
MAKE	CESSNA	
MODEL	R172K	
S/N	R1723000	




LAKESHORE AVIATION
MANITOWOC COUNTY AIRPORT
1815 FREEDOM WAY
MANITOWOC, WI 54220
(920)-682-0043

DATE	12/21/2010
TACH	2396

THESE FLOATS WERE REMOVED FROM N66003 R172K S/N:R1723000.

 JEREMY TROUSIL



A&P 391849627 IA


REG#	N66003
MAKE	WIPAIRE
MODEL	2350
S/N	23023/23024



DATE	4/21/2011
TACH	2411
Control	ta la A-i
and the second	100

THESE FLOATS WERE INSTALLED ON AIRCRAFT N66003 CESSNA R172K S/N R1723000. BRAKES WERE BLED. CYCLED THE LANDING GEAR SEVERAL TIMES AND SERVICED THE POWERPACK RESERVOIR WITH 5606. I CERTIFY THAT THESE FLOATS WERE INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND WERE DETERMINED TO BE AIRWORTHY.

 JEREMY TROUSIL



A&P 391849627 IA

REG# N66003



LAKESHORE AVIATION
MANITOWOC COUNTY AIRPORT
1815 FREEDOM WAY
MANITOWOC, WI 54220
(920)-682-0043

DATE	6/29/2011
175	

INSTALLED TWO NEW FRONT 2.80-2.50-4 TIRES ON FLOATS. SERVICED TIRES TO 50PSI.

JEREMY TROUSIL

T. O

A&P 391849627 IA

REG# N66003

MAKE WIPAIRE

MODEL 2350

S/N 23023/23024



LAKESHORE AVIATION
MANITOWOC COUNTY AIRPORT
1815 FREEDOM WAY
MANITOWOC, WI 54220
(920)-682-0043

DATE	8/1/2011
TACH	2460
	and again Contact of the
	Management of the Control of the Con

I CERTIFY THAT THESE FLOATS WERE INSPECTED IN ACCORDANCE WITH A 100 HOUR INSPECTION AND WERE DETERMINED TO BE AIRWORTHY.

JEREMY TROUSIL

A&P 391849627 IA

REG# MAKE MODEL S/N

JEREM'

INSTALLE

REG# MAKE MODEL S/N

RACES IN THE WITH AN AN JEREM'

INSTALLE

REG# MAKE MODEL S/N

Installe reassemb several tin

Jerem

REG#	N66003
MAKE	WIPAIRE
MODEL	2350
S/N	23023/23024



DATE	9/7/2011
TACH	2497
and the second	in a series of the second series
TO BUT IN S	er agent areas and a second

INSTALLED A NEW LEFT BRAKE CALIPER ANCHOR PLATE P/N 23A04000-109. INSTALLED ALL NEW BRAKE LININGS (8) LEFT AND RIGHT SIDES P/N 066-00106.

JEREMY TROUSIL



A&P 391849627 IA

REG#	N66003
MAKE	WIPAIRE
MODEL	2350
S/N	23023/23024




LAKESHORE AVIATION
MANITOWOC COUNTY AIRPORT
1815 FREEDOM WAY
MANITOWOC, WI 54220
(920)-682-0043

DATE	10/14/2011
TACH	2560
43.4	

INSTALLED 2 RETREADED 5.00-5 MAIN TIRES. INSTALLED 2 NEW BRAKE DISCS P/N RA164-01700. INSTALLED NEW BEARINGS RACES IN THE LEFT MAIN WHEEL P/N 08125 & P/N 08231. I CERTIFY THAT THESE FLOATS HAVE BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND WERE DETERMINED TO BE AIRWORTHY.

 JEREMY TROUSIL



A&P 391849627 IA

REG#	N66003
MAKE	Wipaire
MODEL	2350
S/N	23023/23024



LAKESHORE AVIATION
MANITOWOC COUNTY AIRPORT
1815 FREEDOM WAY
MANITOWOC, WI 54220
(920)-682-0043

DATE	4/13/2012
Tach	2582
100	A AT LOT DO A

Installed a new gear up pressure switch P/N 20PS001EB500W300W. Disassembled both nose gear assembles cleaned and reassembled. Lubed the entire gear system. Installed a new left front tire and tube size 2.80/2.40. Jacked aircraft and cycled the gear several times.

Jeremy Trousil

Jeny this

A&P 391849627 IA

REG#	N66003
- 10.6 Z	and the male term and the same of
_	



DATE	9/18/2012
Tach	2615
2 3 7 2	Business Commence

Installed a new right main gear trailing link arm P/N 21A04000-076. Installed a new right brake caliper torque plate P/N 23A04000-110. Installed 2 new right trailing link gear attachment bolts P/N AN8-33A & P/N 21A05000-019. Installed a new right upper brake hose P/N 21A04000-078. Checked rigging of the right gear. Cycled the landing gear several times.

Jeremy Trousil

A&P 391849627 IA

REG#	N66003
MAKE	Wipaire
MODEL	2350
S/N	23023/23024



LAKESHORE AVIATION
MANITOWOC COUNTY AIRPORT
1815 FREEDOM WAY
MANITOWOC, WI 54220
(920)-682-0043

DATE	11/2/2012
Tach	2642
	Splick Lawrence
A section of	1.04.745.48.88.8

I certify that these floats have been inspected in accordance with an annual inspection and were determined to be airworthy.

Jeremy Trousil

A&P 391849627 IA

Aircraft Log - Cessiva R172K R1723000 N 66003
10-25-2013 Tach - 2714.47 Hrs. Replaced customer
Supplied RH Forward Fuselage to Float strut upright.
From Wipaire, Re-attached hydraulics and electrical
per Wipaire instructions. My Man Att 350905
Noble Aviation LLC Eagle River, WI.

the first transfer and transfer to the second secon
N66003
WipAire
2350
23023/23024



DATE	11/21/2013
Tach	2717
PERSONAL PROPERTY.	

DIAL 2 90/2 50 4 I cortify that these floats have been

Jeremy 7	Trousil	Con	un Tu	FAR 43 App D and were determined to be airworthy.  A&P 3	391849627 IA
	n 1				
N B600	5 10	KH	2766		
Icen	by the	ナナ	lese F2	eds have been Inspected in	
ACCOL	phabi	wic	to an	ANNUAL INSpection por for4	3
Anna	d kida	SVA	home	ads have been Inspected in DNNUPL Duspection por for 4 in pirmody considion En	Ò
1	and k	tort	in It	347 9898	
1 - Swig 1					
	Total				
					The Charles of the Control of the Co

date 1316	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
5-9-16	2777.0			T CXIII So that The second entries.)
		The Paris		AN ANNUAL INSCOTED. AND ARE AIRWOTTED INSCOTED MUD B- Wipaire 2350 Floate
	20	ach so	- spring	3 - Wipaire 2350 Floats 822.13 Hrs. Replaced RH 23A02000-174 RH step 2 each hoses-21A09000-199 21A08525-005. Repaired' Wiring. Rigged per Wipaire
	235	50 Fla	sat Serv	rations. Serviced hyd. Fluid. 3509009 Noble Aviation LLC
	235	50 Fla	sat Serv	rations. Serviced had. Fluid.
	235	50 Fla	sat Serv	rations. Serviced had. Fluid.
	235	50 Fla	sat Serv	rations. Serviced had. Fluid.
	235	50 Fla	sat Serv	rations. Serviced had. Fluid.
	235	50 Fla	sat Serv	rations. Serviced had. Fluid.
	235	50 Fla	sat Serv	rations. Serviced had. Fluid.

4	_	•	
	п	ı	١
	v	r	٠
	-	•	•



DATE: 01AUG2022 TAIL NUMBER: N66003 TACH HOURS: 2940

**HOBBS: 1640.5** 

er of tries.)

Floats & Landing gear require inspection

Removed all access panels on both LH & RH float assemblies and inspected floats and landing gear.

- Both LH & RH gear have side to side play in gear tracks. Removed both LH & RH wheel assemblies' Removed both LH & RH gear assemblies from floats.
- Disassembled LH gear. Re installed LH gear assembly in float with NEW track assemblies' P/N: 21A05114-005 & P/N: 21A05114-006. NEW Axle shock strut upper shaft P/N: 21A04454-006 & Shock strut retainer sleeve P/N: 21A04585-002 and Shock strut retract rollers P/N: 21A05520-003 and assembled with NEW bolts P/N: 21A05000-019, AN8-33A. Reinstalled LH gear assembly in float.
- LH tire worn to limits. Disassembled wheel assembly. Found bearings and races with corrosion. Installed NEW bearings P/N: 08125 and races P/N: 08231. Reassembled wheel with NEW tube P/N: 500x5 tube and tire P/N: 505C61-8 5.00x5 6ply and NEW bolts.
- Disassembled RH gear. Re installed RH gear assembly in float with NEW track assemblies' P/N: 21A05114-005 & P/N: 21A05114-006. NEW Axle shock strut upper shaft P/N: 21A0454-006 & Shock strut retainer sleeve P/N: 21A04585-002 and Shock strut retract rollers P/N: 21A05520-003 and assembled with NEW bolts P/N: 21A05000-019, AN8-33A. Reinstalled RH gear assembly in float.

1 of 2

2 of 2

- Noted RH brake pistons leaking. Disassembled brake pistons, cleaned and inspected assemblies. Installed NEW piston O-rings and re assembled. Both assembly brake pads saturated with hydraulic fluid. Installed NEW brake pads P/N: 066-10600 & re assembled & bleed system. Reinstalled RH wheel assembly after inspecting bearings and races for corrosion. Greased bearings as needed.
- Performed 6 gear retraction cycles. No defects noted at this time.

Work performed I/A/W Wipline 2350 Service Manual & Standard maintenance practices.

Jeffrey E. Houseton A&P 2495125

@ 1991 ASA

Vermont Flight Academy	DATE: 15AUG2022 TAIL NUMBER: N66003 HOBBS HOURS: 1641.6 tions if of ries.)
RH Main tire went flat on ramp a - Jacked airplane, removed whe reassembly. Reinstalled wheel	after flight. eel assembly. Disassembled wheel & installed NEW tube P/N: 302-013-400 at assembly. Serviced tire with air.
Work performed I/A/W Wipline	2380 Maintenance Manual & Standard maintenance practices.
Jerrey . Houghon A&P 2495	125

© 1991 ASA



FLOATS · page 1 of 2

Hildt Aviation Bennington, LLC · 1563 Walloomsac Rd · Bennington, VT 05201 · 866-649-5296

N66003

WIPLINE, 2350, S/N: LH: 23023 RH: 23024

January 22, 2024

TACH: 2953.0

SINCE NEW (TACH):

2324.5

- 1. COLD WORKED SKINS AND AFT KEEL TO ORIGINAL CONTOURS. ORDERED INNER KEEL SPLICE FROM WIPAIRE, REF SRM, REMOVED RIVETS IN REPAIR AREA AND SCRAPED SEALANT. CUT AND BACK DRILLED INTERIOR DOUBLER, DE-BURRED AND APPLIED CHROMATE CONVERSION COATING TO BARE ALUMINUM SURFACES, INSTALLED DOUBLER WET WITH SEALANT AND WITH NEW RIVETS, BACKSEALED SEAMS AND FASTENERS AS NEEDED. Installed P/N 1006769 REPAIR SPLICE Rev/Lot: SO 87868. Installed (4) P/N 1011420 STIFFNER, LH, Installed (4) P/N 21A01005-270 GUSSET, Installed (2) P/N PR1422B2PT SEALANT, Installed (2) P/N 21A01005-270 GUSSET Rev/Lot: SO 87868. Installed (2) P/N 1011420 STIFFNER, LH P/N 21A01005-270 - GUSSET Rev/Lot: SO 87868, Installed (2) P/N 1011420 - STIFFNER, LH Rev/Lot: SO 87868, Installed (6) P/N 1011421 - STIFFNER, RH, Installed (50) P/N CR3213-4-2 - RIVET. Installed (12) P/N CR3213-4-3 - RIVET. Installed (60) P/N CR3213-4-2 - RIVET Rev/Lot: SPRUCE15678632.
- 2. REMOVED AFT (STRAIGHT) SECTION OF LEFT AND RIGHT FLOAT MAIN KEEL EXTRUSION HEMOVED AFT (STRAIGHT) SECTION OF LEFT AND RIGHT FLOAT MAIN KEEL EXTRUSION DUE TO WEAR, DAMAGE, AND IMPROPER REPAIR. REMOVED SHEET METAL SCREWS AND MACHINE SCREWS RETAINING KEELS AND STIFFENERS. REMOVED ALL SKIN STIIENERS AND GUSSETS IN FLOAT STORAGE BAYS DUE TO DAMAGE, CRACKS, LOOSE HARDWARE AND IMPROPER REPAIRS. FABRICATED NEW MAIN KEEL SECTIONS AND MATCH DRILLED TO EXISTING SKINS. MATCH DRILLED PATCH DOUBLERS FOR SPLICE AREAS AND CRACKS. BACK DRILLED SKINS FOR INSTALLATION OF NEW STIFFENERS. DIMPLED SKINS AS NEEDED. INSTALLED NEW KEEL, STIFFENERS, GUSSETS AND DOUBLERS WITH SEALANT. INSTALLED NEW GUSSETS. REMOVED SCREWS AND NUTS RETAINING FOAM BOOSTERS. INSTALLED NEW RIVETS WITH SEALANT. BACK SEALED HARDWARE AND JOINTS AS NEEDED. CLEANED

wo: 2023-023



FLOATS - page 2 of 2

Hildt Aviation Bennington, LLC · 1563 Walloomsac Rd · Bennington, VT 05201 · 866-649-5296

AND APPLIED EPOXY PRIMER TO STORAGE BAYS AS NEEDED. FABRICATED NEW STORAGE BAY DRAIN LINES AND INSTALLED. REFERENCE WIPLINE STRUCTURAL REPAIR MANUAL AND 2100 AND 2350 SERVICE MANUAL.

- COLD WORKED SKINS AND AFT KEEL TO ORIGINAL CONTOURS, ORDERED INNER KEEL SPLICE FROM WIPAIRE, REF SRM, REMOVED RIVETS IN REPAIR AREA AND SCRAPED SEALANT. CUT AND BACK DRILLED INTERIOR DOUBLER, DE-BURRED AND APPLIED CHROMATE CONVERSION COATING TO BARE ALUMINUM SURFACES, INSTALLED DOUBLER WET WITH SEALANT AND WITH NEW RIVETS, BACKSEALED SEAMS AND FASTENERS AS NEEDED.
- COMPLIED WITH ANNUAL INSPECTION PER FAR 43 "APPENDIX D" USING MANUFACTURERS MAINTENANCE DATA AS A GUIDE. CHECKED AD'S. PERFORMED SEVERAL GEAR EXTENSION AND RETRACTIONS. I CERTIFY THAT THESE FLOATS WERE INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND HAS BEEN DETERMINED TO BE IN AIRWORTHY

With respect to the work performed, this FLOATS is approved for return to service. Details of work performed are on file with Hildt Aviation Bennington, LLC under work order: 2023-023.

JAMIE HILDENBRANDT A&P IA 3039160