DATE	TOTAL TIME IN SERVICE	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
		TOTAL brou	ught forward from previous page
12/12/22	5255	TS	Sarasota Avionics Inc Tampa (TPA) 845 Severn Ave. Tampa, Fl 33606 Tail No.: N8310Y/Piper/PA32R-301/Serial #:32R-8113025 Date:12/12/2022 Work Order: M3668 Aircraft Hobbs: 5419.8 Tach: 2889.4 Removed wing tip position/ anti-collision lights and tail strobe, and replaced with new 50 approved Whelen wingtip LED position/ anti-collision lights and LED tail anti-collision light, connected to existing wiring, and revised weight and balance, ops checks good.
		l c wit	certify all work done to the aircraft and/or component identified above was done in accordance the current regulations of the Federal Aviation Administration and was found approved for return to service with respect to the work performed. Steven D. Reifeis A&P 3505535
12/15/2	2525		Sarasota Avionics Inc Tampa (TPA) 845 Severn Ave. Tampa, FI 33606 Tail No.: N8310Y/Piper/PA32R-301/Serial #:32R-8113025 Date:12/15/2022 Work Order: M3668
			Aircraft Hobbs: 5419.8 Tach: 2889.4 Installed owner supplied BM-AIK2A Battery Minder airframe interface kit in fwd baggage compartment per installation instructions, ops checks good.
		а	I certify all work done to the aircraft and/or component identified above was done in accordance with current regulations of the Federal Aviation Administration and was found approved for return to service with respect to the work performed. Steven D. Reifeis A&P 3505535
41. 122			
7/10/23			RIR BELIEVEN SHOULD EVE HARNESS CONETES
			+ REPLACED W/ PMA APPROVED 1+78054-2+
	S 100 100 100 100 100 100 100 100 100 10		H99801-02 FROM PREMIETZ AETZOSTORE.
			RIR BROKEN OVERHEAD VENT LOUVERS.
			JEMWER 3156642
1/12/25			RIR BECKEN STATIC WICK FROM RIGHT SIDE
,			OF STABILATER W/PMA SWID-96-35-50.
			- 31566/2
1/24/23			R/R STRIPPED ROSEN SUN VISOR MOUNT AND
			REPLACED W/NEW, P# 1020100-001, S/N M278975 this page
		SUB-TOTAL	this page 72 MINTENDER 3156642
			rry forward to pay page

DATE	TOTAL TIME IN SERVICE	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK		
		TOTAL brought forward from previous page			
1/24/23 PAC4	2897	a	Sarasota Avionics Inc Tampa (TPA) 845 Severn Ave. Tampa, FI 33606 Tail No.: N8310Y/Piper/PA32R-301/Serial #:32R-8113025 Date:1/23/2023 Work Order: M3698		
TIS	5262,6		Aircraft Hobbs: 2897.0 Adjusted NLG down limit switch, and replaced broken right NLG door return spring. Performed landing gear retraction tests with several fault free cycles.		
		I certify with cur	y all work done to the aircraft and/or component identified above was done in accordance rrent regulations of the Federal Aviation Administration and was found approved for return to service with respect to the work performed. Steven D. Reifeis A&P 3505535		
			States B. Acileia Aur 3000333		
	Repaired and replanew bolt removed screws a hydraulid Adjusted gear retrification accordants.	7/2023 Wor 2897.0 I right NLG d aced rod end aced rod end aced rotes, and loose rivets nd lock nuts, c lines to NLG NLG doors, a action check	per/PA32R-301/Serial Number: 32R-8113025 The Order: M3698 The Or		
2/10/23	2898	2-12	REMOVED AMBAGE LAP BELTS PREVIOUSLY INSTALLED TULY 2007 AND REPLACED WITH NEW BELTS		
	1,2		FROM AIRCRAFT BELTS INC. IAN FARS.		
			315664Z		
			OUNCE		
	-				

TOTAL—Carry forward to next page

Page No. TOTAL TIME RECORDING METER DATE DESCRIPTION OF WORK PERFORMED-IN SERVICE SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK TIME TOTAL brought forward from previous page Sarasota Avionics Inc Tampa (TPA) Airframe 845 Severn Ave. Tampa, Fl 33606 Tail No.: N8310Y/Piper/PA32R-301/Serial Number: 32R-8113025 Date: 5/25/2023 Work Order: M3724 Hobbs: 5437.7 Tach: 2905.7 AFTT: 5141.7 I certify that this aircraft has had an annual inspection IAW FAR43 Appendix D using aircraft manufacturers 100 hour/ annual inspection checklist as a guide and was determined to be in an airworthy condition and is approved for return for service. All applicable airworthiness directives through 5/25/2023 have been reviewed and/or complied with. List in logbook. Verified AD93-05-10 PCW and kit 766-253 installed. Replaced bad low oil pressure switch and reconnected wires. Removed and replaced both brake rotors and all brake pads, nose wheel Lt bearing and race and Lt MLG outbd wheel bearing and race. Checked all lights and servicing, serviced all tires, serviced hydraulic Power pack, lubed airframe, repacked all wheel bearings, bled and serviced brakes. Secured loose gear warning horn, Performed gear retraction checks, with several fault free cycles. Remarked NLG tow limits on strut. Replaced burned wires and connector on cabin air blower motor. Removed and replaced LED landing light with new owner supplied light. Installed required wing fuel placards. Charged aircraft battery, and repaired battery box cover. C/W annual ELT inspection IAW FAR91.207d, ELT battery due July 2023, ops check good. Performed ground run up, all applicable leak and ops checks good. _, Steven D. Reifeis A&P3505535IA Removed broken plastic interior pieces and replaced with new from Premier Aerospace Services and Technology, including PMA part #'s H69989-03, H79542-05, H69654-19, and H69662-12. Replaced pilot and co-pilot Piper Seat Adjustment Springs, part # 587-404, with McFarlane part #MC587-404. Joseph Withers 3156642 Owner, N8310Y Sarasota Avionics Inc Tampa (TPA) 845 Severn Ave. Tampa, FI 33606 Tail No.: N8310Y/Piper/PA32R-301/Serial #:32R-8113025 aviiiiii:s

Date:7/21/2023 Work Order: M3816

Aircraft Hobbs: 2937.3

Adjusted gear warning throttle switch, and slightly lowered left aileron per owners request. Performed nose gear alignment and adjusted rudder peddals foreward to neutral vertical position. Rigged rudder controls, adjusted rudder peddal stops, and reset rudder cable tension to spec. per AMM chap. 27 and 32. Removed and replaced landing light Molex connector fwd of firewall, ops checks good.

I certify all work done to the aircraft and/or component identified above was done in accordance with current regulations of the Federal Aviation Administration and was found approved for return to service with respect to the work performed.

SID. Al

Steven D. Reifeis A&P 3505535

TACH OR

Executive HeliJet Aviation Myrtle Beach International Airport 3301 Mustang Street Myrtle Beach, SC 29577



Date: 2/28/2022; Aircraft: N8310Y; Type: PIPER-PA-32R-301; S/N: 32R-8113025; Tach: 2869.70; Total Time: 5105.70

COMPLIED WITH ANNUAL INSPECTION IN ACCORDANCE WITH PIPER MAINTENANCE MANUAL AND ANNUAL/100 HOUR CHECKLIST.

COMPLIED WITH ANNUAL ELT INSPECTION IN ACCORDANCE WITH FAR 91.207d. NO DEFECTS NOTED. ELT BATTERY EXPIRATION DATE 7/2023

TROUBLESHOT LEFT NAV LIGHT, FOUND BUILS CONNECTIONS WORN AND NOT MAKING CONTACT. REPAIRED CONNECTION AND REINSTALLED ASSEMBLY,

OPERATIONAL CHECK SATISFACTORY, REMOVED, CLEANED, REBUILT AND REINSTALLED 3 BRAKE MASTER CYLINDERS (PILOT LEFT AND RIGHT) (COPILOT

OPERATIONAL CHECK SATISFACTORY, REMOVED, CLEANED, REBUILT AND REINSTALLED 3 BRAKE MASTER CYLINDERS (PILOT LEFT AND RIGHT) (COPILOT

OPERATIONAL OF SERVICED WITH 5606. NO LEAKS NOTED AT THIS TIME. REMOVED OLD WINDSHIELD SEALANT, CLEANED AND PREPPED AREA AND

LEFT) SYSTEM BLED AND SERVICED WITH 5606. NO LEAKS NOTED AT THIS TIME. REMOVED OLD WINDSHIELD SEALANT, CLEANED AND PREPPED AREA AND

APPLIED NEW SEALANT ON WINDSHIELD. REMOVED AND REPLACED PROP GOVERNOR CABLE WITH NEW 554-350 CABLE. RIGGED AND OPS CHECK

SATISFACTORY. REMOVED AND REPLACED FUEL PLACARDS ON BOTH WINGS. RECONNECTED ALT AIR DOOR CABLE BACK ON AIRBOX WITH NEW HARDWARE.

OPERATIONAL TEST SATISFACTORY.

REMOVED AND REPLACED STEERING ROLLERS ON NOSE GEAR IAW PIPER M/M. REMOVED AND REBUILT LT MLG STRUTTAW PIPER M/M. REINSTALLED STRUTT

ASSEMBLY REMOVED AND REPLACED ALL MLG WHEEL BEARING, RACES AND ATTACHING PARTS. REMOVED AND HEPLACED ELT BATTERT WITH THE ASSEMBLY. EXP. 7/2023
REMOVED AND REPLACED RT WING LIGHT LENS.3727598 REMOVED AND REPLACED BOTH LT AND RT ELEVATOR TIPS.
REMOVED AND REPLACED RT WING LIGHT LENS.3727598 REMOVED AND REPLACED BOTH LT ANTENNA REMOVED AND SEVERE CORRSION ON BELLY OF A/C. CORRSION FORWARD ANTENNA REMOVED AND SEVERE CORRSION ON BELLY OF A/C. CORRSION REMOVED AND SEVERE CORRSION ON BELLY OF A/C. CORRSION REMOVED AND FLUSH PATCH FABRACATED AND INSTALLED FOR MOUNTING ON NEW ANTENNA. REPLACED 3 MISSING STATIC WICKS,2 ON RIGHT WING INCLUDING ONE RIVNUT AND ONE WICK ON LEFT WING.
TROUBLESHOT SYSTEM, FOUND BROKEN BRACKET ON MLG NOSE ASSEMBLY. REPAIRED NOSE ASSEMBLY WITH FABRACTED BRACKET, CHANGED FORWARD TROUBLESHOT SYSTEM, FOUND BROKEN BRACKET ON MLG NOSE ASSEMBLY. REPAIRED NOSE ASSEMBLY WITH FABRACTED BRACKET, CHANGED FORWARD TROUBLESHOT SYSTEM, FOUND BROKEN BRACKET ON MLG NOSE ASSEMBLY WITH FABRACTED BRACKET, CHANGED FORWARD TROUBLESHOT SYSTEM. FOUND BRACKET, CHANGED FORWARD TROUBLESHOT SYSTEM, FOUND BRACKET, CHANGED FORWARD TROUBLESHOT SYSTEM AND REPLACED BOTH LEFT AND SPRING AND RETESTED EMERGANCY GEAR DUMP, OPERATIONAL GROUND TEST SATISFACTORY DEFULED A/C, REMOVED AND REPLACED BOTH LEFT AND SOTH MAIN AIRSTOP TUBES. REMOVED AND RIGHT WING INTERCONNECT FUEL HOSES ON TANKS REMOVED AND REPLACED BOTH MAIN 6X6 AIRHAWK TIRES AND BOTH MAIN AIRSTOP TUBES. REMOVED AND BUNDLE. REMOVED AND BRACKET FOR A SATISFACTORY AND SCALED AFTER OVER HAUL.

BUNDLE. REMOVED AND REBUILT HAND BRAKE IN ACCORDANCE WITH CLEVELAND MANUAL. OPS CHECK GOOD, PROPELLER GOVERNOR REMOVED AND SENT TO HAH PROPELLE SERVICE FOR OVERHAUL. DETAILS OF WORK ON WOW 224839. PROPELLER GOVERNOR REINSTALLED AFTER OVERHAUL.

SENT TO HAH PROPELLA SERVICE FOR OVERHAUL, DETAILS OF WORK ON WOW 224839. PROPELLER GOVERNOR REINSTALLED AFTER OVERHAUL.

SENT TO HAH PROPELLA SERVICE FOR OVERHAUL, DETAILS OF WORK ON WOW 224839. PROPELLER GOVERNOR REINSTALLED AFTER OVERHAUL.

SE

BRANDON CRISP A&P 3727598 IA

I CERTIFY THAT THIS AIRCRAFT HAS BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND IS DETERMINED TO BE IN AIRWORTHY CONDITION. FOR PETURN TO SERVICE.

Aeroborne Enterprises 538 Beacon Rd, Sylvania, Georgia 30467 912-857-3220, aerobornehank@yahoo.com

10-15-2022

Tach: 2872.8

N8310Y

Aircraft sanded and painted by Southeastern Aircraft Painting, Inc. Checked control surface balance as per Piper Service Manual. Replaced hardware as necessary. Greased and cycled gear. Filled gear and brake reservoirs. Installed new Airtex Carpet. Repaired front seats as necessary. Installed overhauled Turn Coordinator PN 1394T 100-72, SN 8010-810. Repaired broken alternator inop light wire. Repaired broken avionics master switch.

Paint Codes: PPG ESSS903653 white 5906 Phantom Grey

Hank Maierhoffer A&P 262832460

SUB-TOTAL this page

TOTAL—Carry forward to next page