

N2852W

CFS

June 21,
1973

Feb 19, 1980

AIRCRAFT LOG

REMARKS

5

DATE

INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS

6-21-73

In accordance with F. A. R. 91.25

Omni directional receivers
were found to be accurate to
within 3° degreesI certify that altimeter and static system tests
required by FAA Part 91.170 have been performed.

Static system test date 6-9-73.

Altimeters tested to 80,000 feet.

LH Altimeter SN 92829, Date 5-9-73.

RH Altimeter SN N/A, Date N/A.

Bill Thompson 7-23-73
Pilot or Radio date
Crew chief

FOR BEECH AIRCRAFT CORP., DOA, PC#8

REMARKS

7

DATE

INSPECTION — MAINTENANCE — REPAIRS — ALTERATIONS

8-30-73

Tulsa W.O. 17601

Removed KX120B, K1201C indicator, standard gyro horizon
and directional gyros. Installed 2 Naves Comm 11A,
Naves Nav 11 and 12, Naves marker beacon, Naves 20 DME
Naves ATIS Transponder, Naves CP-25 Radio System,
Bendix FCS 810 Auto Pilot. See 337 checklist for
details. Static system leak checked. Weight and
Balance data computed.
as follows.

Basic Empty Weight = 3609.185.

C. G. = + 77.4 in.

Moments = 279330

Gross Weight = 5400 lbs.

Useful Load = 1791 lbs.

The aircraft, airframe, aircraft engine, propeller, or appliances
identified above was repaired and inspected in accordance
with current Regulations of the Federal Aviation Agency and is
approved for return to service.

Under Order No. 17601

Date 8-30-73

Signed *Charles Dean*
(signature of authorized representative)

Tulsa Beechcraft Inc

R. S. # 3657

Box 8127, International Airport, Tulsa, Oklahoma

REMARKS

9

DATE

INSPECTION — MAINTENANCE — REPAIRS — ALTERATIONS

11-7-73 Homebase 98.0hr Total Airframe 98.0hr New Fire Extinguishers
 Installed FAA Form 337 & Air Balance Checked, Replaced Left Main Leg
 Bolt, Fixed Wire Bundle to prevent chaffing on contact sensor. Adjusted
 Left Control Head micro Switch, Replaced Dzus Fasteners on Eng air Box,
 Replaced Left Wing Root Cover Plate AD'S Checked thru 73-72-Sens
 Index

"I CERTIFY THAT THIS

Accra Ft

HAS BEEN

DATE 11-7-73 SIGNATURE

120561

INSPECTED IN ACCORDANCE WITH

100.100

CENTRAL FLYING SERVICE LITTLE ROCK, ARK.

INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION."

REPAIR STA. CERT. NO. 3818

REMARKS

DATE

INSPECTION — MAINTENANCE — REPAIRS — ALTERATIONS

11

11-27-73 Hardness Inspection performed per SI (AD 74-13-1) acceptable. Beech Aircraft Corporation Service Department
N-S. Wagner 27 Nov 1973

DATE		NATURE OF FLIGHT	No. of Pass.	TIME OF FLIGHT		TIME IN AIR		Miles Flown	REPAIRS — ADJUSTMENTS — REMARKS	SIGNATURE
Up	Down	Hours	Min.							
		12-11-73	HORR METER	146.1					Installed 2 new main gear tires + installed new brake linings on both sides	
PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER DATE 12-11-73 SIGNATURE <i>William N. Smith</i> 20708 CENTRAL FLYING SERVICE LITTLE ROCK, ARK. REPAIR STA. CENT. NO. 3818										
12-27-73 HORN METER 161.5 HRS. Removed Altimeter swing to 80° returned for modification on battery Mod 1 Filed Altimeter SN A-1507 Certified to 20000 FEET 12-15-73 installed Static System Certified as per FAR 91.170. 20 Feet test LEAD DRAG										
PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER DATE 12-27-73 SIGNATURE <i>William N. Smith</i> 20751 CENTRAL FLYING SERVICE LITTLE ROCK, ARK.										

REMARKS

13

DATE

INSPECTION — MAINTENANCE — REPAIRS — ALTERATIONS

2-16-74 HOURMETER 201.0 AIRCRAFT TOTAL TIME 201.0

INSTALLED NEW BRAKE LINES IN LH BRAKE ASSY. SERVICED DE-ICE FLUID
RESERVOIR, INSTALLED NEW EYEBOAT AND ADJUSTED RH LG. GEAR DOOR.

I CERTIFY THAT THIS AIRCRAFT HAS BEEN

INSPECTED IN ACCORDANCE WITH #2 100 HOUR

INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION.

PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER 20930

DATE 2/16/74 SIGNATURE

CENTRAL FLYING SERVICE LITTLE ROCK, ARK.

REPAIR STA. CERT. NO. 3818

DATE	NATURE OF FLIGHT	No. of		TIME OF FLIGHT		TIME IN AIR		Miles Flown	REPAIRS - ADJUSTMENTS - REMARKS	SIGNATURE	LIC. No.
		Pass	Up	Down	Hours	Min.	Hours				
4-27-74	HOURLY	306.0	(A/C IT. 306.0)								
INSTALLED ALL NEW BRKE LINES IN LTR BRKE ASSYS. REPAIRED ALL WHEEL BEARINGS. C/W 5/1 0639-150. (INSP. FOR PROPER SCREWS IN RUDDER, ELEVATOR HINGES + RUDDER, ELEVATOR, ALICRON BELT- CHAINS).											
I CERTIFY THAT THIS Aircraft HAS BEEN INSPECTED IN ACCORDANCE WITH Annual											
INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION.											
PERTINENT DETAILS ARE ON FILE AT THIS POINT UNDER JOB NUMBER 3122											
DATE 4-27-74 SIGNATURE <i>[Signature]</i> CENTRAL FLYING SERVICE LITTLE ROCK, ARK. REPAIR STA. CERT. NO. 3818											
TOTALS FORWARD											
TOTALS TO DATE											

DATE	REMARKS
5-14-74	Hourly 305.1
5-25-74	Hourly 325.2
5-25-74	PAINTED LEADING EDGES OF A/C. INSTALLED 8 DAY CLOCK OVER- Hauled BY ART-TESTS, INC., W.O. #06498. INSTALLED NEW R/H NAV. LIGHT LENS, REPAIRED WRITING DESK IN A/C. MOVED HOURLY METER. FROM LOWER CENTER OF CONSOLE TO UPPER R/H CORNER OF INST. PANEL.
PERTINENT DETAILS ARE ON FILE AT THIS POINT UNDER JOB NUMBER 21284 DATE 5-25-74 SIGNATURE <i>[Signature]</i> CENTRAL FLYING SERVICE LITTLE ROCK, ARK. REPAIR STA. CERT. NO. 3818	

DATE	NATURE OF FLIGHT	TIME OF FLIGHT		TIME IN AIR		Miles Flown	REPAIRS - ADJUSTMENTS - REMARKS	SIGNATURE
		Pass	Up	Down	Hours			
11 SEP 1974	Hourometer	410.0	410.0	Total Act Time	410.0	A.O.S. 11/1/74		
Thru 74-18-140EX								
1) CERTIFY THAT THIS <u>Aircraft</u> HAS BEEN PERMANENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER <u>DATE 9-11-74</u> SIGNATURE <u>[Signature]</u> INSPECTED IN ACCORDANCE WITH <u>100 Hour</u> CENTRAL FLYING SERVICE LITTLE ROCK, ARK. INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION." REPAIR STA. CERT. NO. 3818								
2) 11 SEP 74 Hourometer reading 410.0 removed compass of log & Reinstalled compass 416 752970 check & Build								
TOTALS FORWARD								
TOTALS TO DATE								

DATE	REMARKS
27 NOV 1974	Hourometer 5130 Miles Total Act Time 5130 Hours E.H.
	Prop Removed & Shipped To L. Walter For Repairs Reinstated
	Flt Manual Reused, Replaced Plate together & rechecked, Replaced Bulbs in Test
	Bottom Rotating Bearings, Brake Blocks Replaced Both Sides, wing keel
	EDGES Repainted, A.O.S. Checked Thru 74-93-Service INDEX.
1) CERTIFY THAT THIS <u>Aircraft</u> HAS BEEN PERMANENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER <u>DATE 11-27-74</u> SIGNATURE <u>[Signature]</u> INSPECTED IN ACCORDANCE WITH <u>100 Hour</u> CENTRAL FLYING SERVICE LITTLE ROCK, ARK. INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION." REPAIR STA. CERT. NO. 3818	

DATE	NATURE OF FLIGHT	No of Pass	TIME UP			AIR	Miles Flown	REPAIRS - ADJUSTMENTS - REMARKS	SIGNATURE	LOGS
			Up	Down	Hours					
12-9-74	Nonometer					537.3465		meter modified. Unit installed		
1 certify that the static system test required by FAR part 91.117										
has been performed using master testing model no. 334										
checked per FAR 91.170.										
12-9-74										
Certificate No. 3818										
PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER										
DATE 12-9-74 SIGNATURE <i>[Signature]</i> 22249										
CENTRAL FLYING SERVICE LITTLE ROCK, ARK.										
REPAIR STA. CERT. NO. 3818										
TOTALS FORWARD										
TOTALS TO DATE										

DATE	INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS	REMARKS
12-11-74		
PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER		
DATE 12-11-74 SIGNATURE <i>[Signature]</i> 22284		
CENTRAL FLYING SERVICE LITTLE ROCK, ARK.		
REPAIR STA. CERT. NO. 3818		
3-7-75		
Nonometer reads 601.8. Repainted wing leading edges & fairings w/ Dupont Imron 8174 white polyurethane. Fuel fillers Regreased		
12-26-75		
PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER		
DATE 12-26-75 SIGNATURE <i>[Signature]</i> 2226371		
CENTRAL FLYING SERVICE LITTLE ROCK, ARK.		
REPAIR STA. CERT. NO. 3818		

DATE	NATURE OF FLIGHT	TIME OF FLIGHT			TIME IN AIR			Miles Flown	REPAIRS - ADJUSTMENTS - REMARKS	SIGNATURE	LIC. No.
		Pass	Up	Down	Hour	Min					
4-4-78	Houmeier	6:17	44	AS					Total Aircraft Time 6:17.4 Hours		
SE 0514-035	6632-282								Adoo Door Stop Repaired		
	Writing Table Repaired, Replaced the instrument light bulb, Replaced								Executive		
	Nose Wheel Tire, ABS checked then 75-7-1 under										
7) ENTRY THAT THIS Aircraft HAS BEEN NOTED IN ACCORDANCE WITH <u>Annual</u> DATE <u>4-4-78</u> SIGNATURE <u>[Signature]</u> 32694 REPAIRS AND WAS INTERVIEWED TO BE IN AIRCRAFT CONDITION CENTRAL FLYING SERVICE LITTLE ROCK, ARK. REPAIR STA. CERT. NO. 3818											
25 JUN 1978	Houmeier	6:19	6	MS					Arrived PH Prop Done, installed		
	Altitude corrected to 24000 ft 11-25, State system checked per FAR 91.11a										
	Altitude Pressure Gauge overhauled by AER INST & Re-installed										
TOTALS FORWARD DATE <u>6-25-78</u> SIGNATURE <u>[Signature]</u> 23144 CENTRAL FLYING SERVICE LITTLE ROCK, ARK. REPAIR STA. CERT. NO. 3818											

REMARKS	
DATE	INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS
7-17-75	Houmeier 710.3 was Replaced All Backhousings with out Bond Back Pad
PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER <u>33252</u> DATE <u>7-17-78</u> SIGNATURE <u>[Signature]</u> CENTRAL FLYING SERVICE LITTLE ROCK, ARK. REPAIR STA. CERT. NO. 3818	

DATE	NATURE OF FLIGHT	TIME UP		TIME IN		Miles Flown	REPAIRS - ADJUSTMENTS - REMARKS	SIGNATURE	LICENS. NUMBER
		Pass	Up	Down	Hours				
13 AUG 1975	Hourmeter 727.540 hrs								
ST 0632-28094, Replaced one bearing Race RH MLG wheel, 1st 1/2 NEW BRAKE DISC RH Sides bearings in both BRAKES Replaced both in 1st light frame, new "O" Rings installed at Master Brake Cylinder, Serviced BRAKE RESERVOIR, cleaned & repaired all wheel bearings, Serviced Serviced & Recharged, Replaced Terminal end RH Fuel Vent Heater, C/U AD 75-16-10 Replaced elevator Trim Tab Actuating Rods, AD's checked Then 75-16-10 index.									
PERMITS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER 23373 DATE 13 AUG 1975 SIGNATURE <i>Kenneth D. [Signature]</i> INSPECTED IN ACCORDANCE WITH 7-100 Hour CENTRAL FLYING SERVICE LITTLE ROCK, ARK INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION, REPAIR STA. CERT. NO. 3818									
TOTALS FORWARD TOTALS TO DATE									

REMARKS	
DATE	INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS
11 November 1975	(Hour meter) 877.6 hrs. Installed new upper elevator trim hinge channel & new trim hinge on left elevator. Installed new hinge on right also. Revised existing hinge pin. Rigging checked per Beech service manual.
PERMITS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER 23577 DATE 9-16-75 SIGNATURE <i>James W. [Signature]</i> CENTRAL FLYING SERVICE LITTLE ROCK, ARK REPAIR STA. CERT. NO. 3818	
11 November 1975 (Hour meter) 877.6 hrs. Installed NEW BRAKE RODS on LH & RH wheels and installed NEW BRAKE DISC on LH wheel.	
PERMITS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER 23835 DATE 11/17/75 SIGNATURE <i>Steve W. [Signature]</i> CENTRAL FLYING SERVICE LITTLE ROCK, ARK REPAIR STA. CERT. NO. 3818	

REMARKS	
DATE	INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS
7 CERTIFY THAT THIS INSPECTED IN ACCORDANCE WITH INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION.	Aircraft HAD BEEN 100 Hour #1 Insp. Suid 118662D
JUN 16 1976 New Dicky kinings. Re worked left & right kinings, new D-riings. DATE 6-16-76 SIGNATURE Kenneth H. Smith CENTRAL FLYING SERVICE LITTLE ROCK, ARK REPAIR STA. CENT. NO. 3818	PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER 35144 DATE 6/3/76 SIGNATURE Kenneth H. Smith CENTRAL FLYING SERVICE LITTLE ROCK, ARK REPAIR STA. CENT. NO. 3818 left Main bear, installed

DATE	NATURE OF FLIGHT	No. of Pass	TIME OF FLIGHT		TIME IN AIR		Miles Flown	REPAIRS - ADJUSTMENTS - REMARKS	SIGNATURE	LICENS. NUMBER
			Up	Down	Hours	Mins				
JUN 21 1976										
	Hourmeter 1040.3 TAT 1040.3 hrs.									
	Aircraft weighing due.									
	New aircraft basic weight : 3625									
	Basic wt. Moments : 280950.85									
	A/c Basic weight CG : 77.50									
	A copy of weight & Balance form is inserted in									
	Section 7 of 2-80's Operating Manual and Acft Flight Man.									
PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER DATE 6/21/76 SIGNATURE James W. Smith Jr. CENTRAL FLYING SERVICE LITTLE ROCK, ARK. REPAIR STA. CERT. NO. 3818										
TOTALS FORWARD										
TOTALS TO DATE										

DATE	REMARKS
SEP 9 1976	Hourmeter 1152.8 TAT 1152.8 hrs -
	SI 0632-280 C/W on inspection for leakage from fuel cello - Install quick disconnect pin on center seats - Pilot's seat sent to upholstery shop for repair and reinstalled - Service brake reservoir - Service de-icing fluid reservoir - Install 4 ea new brake wheels on RT Main wheel - Install new fueling, hot and weather
CONTINUED NEXT PAGE	
INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER DATE 9-10-76 SIGNATURE James W. Smith CENTRAL FLYING SERVICE LITTLE ROCK, ARK. REPAIR STA. CERT. NO. 3819	

34		TIME OF				TIME IN		Miles		REPAIRS - ADJUSTMENTS - REMARKS		SIGNATURE	
DATE	NATURE OF FLIGHT	No. of Pass.	Up	Down	Hours	Min.	Flown						
	to eliminate looseness in nose torque knee -												
	Repair hydraulic line on right brake (chaffing) -												
	Adjust Lt. throttle warning horn micro-switch -												
	Adjust Retraction Gear Stop micro-switch -												
	Also checked thru 76-17 under - Installed new												
	terminal bending stop on Rt flap -												
	Note SE 332 16 Chid wiring on Electric Elevator Tab Actuator: N/A												
BY CERT THAT THIS		Aircraft		HAS BEEN									
INSPECTED IN ACCORDANCE WITH		100 HOUR		TA. 118680									
PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER 25809													
DATE 090978 SIGNATURE <i>James H. Smith</i>													
CENTRAL FLYING SERVICE LITTLE ROCK, ARK.													
REPAIR STA. CERT. NO. 3818													
TOTALS FORWARD													
TOTALS TO DATE													

35		REMARKS	
DATE	INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS		
00114	1976 Hourmeter 1179.2 TAT 1179.2 hrs		
	Change Right engine (Continental)		
	Engine removed IO-520-C1 SIN 172518R		
	Engine installed R. IO-520-C5B SIN 172867-R		
	Propeller HARTZELL BHC J2YF-2C/FC84 75B6		
	SIN D2 119 removed for overhaul at Lt.		
	WALKER COMPANY and reinstalled -		
	At the time of installation:		
	Engine Rao 'ZERO" hr. TS Reb.		
	Drop Rao '0" hr. TS MDH.		
PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER 25809			
DATE 1010-26 SIGNATURE <i>James H. Smith</i>			
CENTRAL FLYING SERVICE LITTLE ROCK, ARK.			
REPAIR STA. CERT. NO. 3818			

DATE	NATURE OF FLIGHT	TIME OF FLIGHT		TIME IN AIR	Miles Flown	REPAIRS - ADJUSTMENTS - REMARKS	SIGNATURE	USING
		Up	Down					
NOV 18 1976	Hourmeter	1230.4	TAT	1230.4 hrs.				
Recurring inspections SIN 0514-035# 0632.880 C/W (see compliance records in back of this log) ST 0851. 108 C/W on Emergency exit hatch inspection - Replace fwd bulbs in both upper & lower rotating beacon - Replace replace forward beacon light bulb - stop drill skin crack around Lt elevator mounting bar - Install valve stem cap in R/hydr. accumulator - Replace top beacon lens checked thru 76-22 index -								
II CERTIFY THAT THIS AIRCRAFT HAS BEEN INSPECTED IN ACCORDANCE WITH <u>Annex A</u> DATE <u>11/13/76</u> SIGNATURE <u>[Signature]</u> CENTRAL FLYING SERVICE LITTLE ROCK, ARK. REPAIR STA. CERT. NO. 3818								
TC TOTALS TO DATE								

DATE	REMARKS
DEC 22 1976	Hourmeter 1262.3 TAT 1262.3 hrs.
Installed overhauled Haniford pressure gauge type 1V0 28-202.4 SIN 3844. (tag in envelope)	
INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS	
DATE 122276 SIGNATURE <u>[Signature]</u> 262375 CENTRAL FLYING SERVICE LITTLE ROCK, ARK. REPAIR STA. CERT. NO. 3818	
NOV 7 1977	Hourmeter 1274.8 TAT 1274.8 hrs
I certify that the static system Magnetic Compass C-2400-4P- test required by FAR part 91.170 14B removed for O/H & calibration have been performed using and reinstalled - Actuator U.I. Tactair test, model no. 384, P/N 5934-467 SIN 846446 removed Date <u>Nov 7 1977</u> for O/H and calibration to 20,000 ft Certificate No. <u>3818</u> CONTINUED NEXT PAGE	

PARTNENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER 56346
DATE 2/12/77 SIGNATURE *James M. Smith*
CENTRAL FLYING SERVICE-LITTLE ROCK, ARK
REPAIR STA. CERT. NO. 3818

REPAIR SIA. UENI. NU. 2020

--	--

JAN 14 1977 Hourmeter 1279.3 TAT 1279.3

Replaced K/Hatch generator, unit installed type MS 20382
SIN 16475. Installed left cow flap actuator, unit installed
P/N 10927H100-F25, Mod 90-380021-17 SIN 1104.

0283377 - Instr./load news Directm Gyro-Autopilot Type 4000 294-850
~~577287~~ W.O. 26608-
 PERMMENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER 26

100

DATE 01/14/77 SIGNATURE Thomas W. Smith

TOTALS TO DATE		CENTRAL FLYING SERVICE LITTLE ROCK, ARK.
JOURNALS FORWARD		REPAIR STA. CERT. NO. 3818

JAN 24 1977 Hourmeter 1281.3 TAT 1281.3 hrs

Replaced cow! Flap actuator, unit installed rebuild
P/N 1093TH100-F2S S/N 1868 (Tag in envelope)
Right propeller removed for repair and reinstalled on
same side —

PENITENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER 26417
 DATE 012477 SIGNATURE James N. Smith
 CENTRAL FLYING SERVICE LITTLE ROCK, ARK.
 REPAIR STA. CERT. NO. 3818

REPAIR SIA. CERL. NO. 3818

~~1~~ Feb. 4, 1977 Hummer 12858 Installed new

the left cable on right engine. Installed new mic switch on left control flap motor. Ground ran checked OK

Yonnet L. Lat
At 432085031

REMARKS	
DATE	INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS
MAR 15 1971 Hourmeter	1325.8 TAT 1325.8 hrs
C/W recurring inspections: SI's 0632-280 & 0846-152, see compliance records in back of this log. Installed chain on fuel cap & wing. Replaced Lt. fuel cap O-ring. Installed cigarette lighter element. Installed new faring and cover on Rt. wing (lower). Replaced 4/11 outbd seal. Adjusted Lt. throttle horn switch. Replaced D.C. post light bulb. Replaced horn last lamp. Installed aileron indicator for window - ADS checked thru 77-04 index.	
CERTIFY THAT THIS <u>Aircraft</u> HAS BEEN	PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER <u>26721</u>
INSPECTED IN ACCORDANCE WITH <u>100 Hour #1</u>	DATE <u>081572</u> SIGNATURE <u>James W. Smith</u>
INSPECTION WAS DETERMINED TO BE IN AIRWORTHY CONDITION.	GENERAL FLYING SERVICE LITTLE ROCK, ARK
<u>Back I.C. 1156620</u>	REPAIR STA. CERT. NO. 3818

DATE		NATURE OF FLIGHT		TIME OF FLIGHT		TIME IN AIR		Miles Flown		REPAIRS - ADJUSTMENTS - REMARKS		SIGNATURE		LICENSE NUMBER	
42															
DATE		NATURE OF FLIGHT		TIME OF FLIGHT		TIME IN AIR		Miles Flown		REPAIRS - ADJUSTMENTS - REMARKS		SIGNATURE		LICENSE NUMBER	
4/18/77		PAID 43		FOR COMPLIANCE w/ FAR 91.177						PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JGB NUMBER 27023					
										DATE 4/18/77 SIGNATURE [Signature]					
										CENTRAL FLYING SERVICE LITTLE ROCK, ARK.					
										REPAIR STA. CERT. NO. 3818					
MAY 12 1977		Hourmeter 1384.0		TAT 1384.0 hrs											
		Installed new Goodyear 6.50 x 8 Main Tires on Lt & Rt side.		Installed new brake linings on Lt & Rt main side.		Installed new bearings & races in Rt Main Gearwheel.		Installed new bearing & throttle warning horn.		Tacked A/C & adjusted Lt cover on Rt. lower wing.		Replaced missing bulb cover on Lt Eng EGT & EGT instrument.		Installed new probe on Lt Eng EGT & EGT instrument.	
TOTALS		TOTALS FORWARD		TOTALS TO DATE											

DATE		REMARKS	
43			
		INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS	
JUN 16 1977		Hourmeter 1427.1 TAT 1427.1	
		C/W recurring inspections: S.S.'s 0632-2808 0846-152, see compliance records in back of this log -	
		Repaired Lt lower nose bowl (cracked & holed) - Installed new points & adjusted points on throttle warning -	
		Replaced rear bulb on Top beacon - Repaired Pilot's & copilot's seat upholstery - Adjusted play in Lt Elev. Trim Tab by changing bolts - Replaced Rt landing light - Installed a ea new plugs on Lt Brake -	
		CONTINUED NEXT PAGE	
		checked at Inst. Shop -	
		PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JGB NUMBER 27023	
		DATE 05/18/77 SIGNATURE [Signature]	
		CENTRAL FLYING SERVICE LITTLE ROCK, ARK.	
		REPAIR STA. CERT. NO. 3818	

FLIGHT LOG

DATE	NATURE OF FLIGHT	No. of Pass.	TIME OF FLIGHT	TIME IN AIR		Miles Flown	REPAIRS - ADJUSTMENTS - REMARKS	SIGNATURE	LICENSE NUMBER
				Up	Down				
up dated Pilot's operating Manual PIN 58-590002-1341 with Supplement PIN 131407, wet wing tip fuel system. AD's checked thru 77-10 index									
Aircraft <u>100 Hour #2</u> HAS BEEN INSPECTED IN ACCORDANCE WITH <u>100 Hour #2</u> PARTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER AND NUMBER <u>87205</u> DATE <u>061677</u> SIGNATURE <u>John W. [Signature]</u> CENTRAL FLYING SERVICE TITLE NOCK, ARK. REPAIR STA. CERT. NO. 8818									
TOTALS FORWARD									
TOTALS TO DATE									

REMARKS

DATE	INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS
1-7-77	Hour meter 1453.7 replaced right engine oil pressure gage with overhauled unit. Oil filter tag in rear of filter book. AP 500539346 suspended
06307	Hourmeter 4.1 TAT 1540.0 hrs
C/W recurring inspections: AD 76-07-12, SI 0514-035, 0632-280 & 0846-152, See compliance records in back of this logbook - AD 76-02-07 & Prestolite SB# ASM-10 (See engine log) - AD 77-12-07 on Hagners (See engine log) - AD 76-16-02 on Dry Air Pump Airborne found replacement not due - 11E Pump due 050181, R/E Pump due 040181 - AD 77-12-06 & Hartgill SB# 118A C/W by removing both props for compliance at OH facility - See entries in back of engine logbooks -	

CONTINUED NEXT PAGE

REMARKS

47

INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS

DATE

THIS TRANSPONDER

MAKE MAICO MODEL AT 50-A S/N 25463

HAS BEEN TESTED AND INSTALLED AND FOUND TO COMPLY WITH
APPENDIX F OF PART 43 IN ACCORDANCE WITH FAR 117

DATE 11/16/77 SIGN [Signature]

CERTIFIED AIRCRAFT ENGINEER

ADAMS FIELD
LITTLE ROCK, ARK.
REPAIR STATION 3818

CONTINUED NEXT PAGE

CONTINUED NEXT PAGE

REMARKS

INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS

DATE _____

SI 0957 on vent hose (fuel syst) C/W on #4. No residue found.
Installed new VISO on RH side. Installed new
680-8 6 ply tire on RH 11/16. Replaced 2 ea bulbs
on RH side brake. Installed new BEACON Army
PIN 40-0127-1 SIN 598 & 2 new bulbs.
AD's checked thru 77-23 index.

Aircraft _____ HAS BEEN _____

IN CERTAIN THAT THIS _____
INSPECTED IN ACCORDANCE WITH 100 Hour #1
INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION. #

Bech I & 1186623

PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER 28840 &
DATE DEC 14 77 SIGNATURE [Signature] 77-288292
CENTRAL FLYING SERVICE LITTLE ROCK, ARK
REPAIR STA. CERT. NO. 3818

INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS

DATE _____

SI 0957 on vent hose (fuel syst) C/W on #4. No residue found.
Installed new VISO on RH side. Installed new
680-8 6 ply tire on RH 11/16. Replaced 2 ea bulbs
on RH side brake. Installed new BEACON Army
PIN 40-0127-1 SIN 598 & 2 new bulbs.
AD's checked thru 77-23 index.

Aircraft _____ HAS BEEN _____

IN CERTAIN THAT THIS _____
INSPECTED IN ACCORDANCE WITH 100 Hour #1
INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION. #

Bech I & 1186623

PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER 28840 &
DATE DEC 14 77 SIGNATURE [Signature] 288292
CENTRAL FLYING SERVICE LITTLE ROCK, ARK.
REPAIR STA. CERT. NO. 3818

FLIGHT LOG

DATE	NATURE OF FLIGHT	No. of Pass.	TIME OF FLIGHT	TIME IN AIR		Miles Flown	REPAIRS - ADJUSTMENTS - REMARKS	SIGNATURE	LICENSE NUMBER
				Up	Down				
NOV 27	Houma to 192.4 TH		1728.3 hrs						
	C/W returning inspections. AD 76.0712, SI's 0632.								
	280, 0846-152 & 600year SR# FT-77-1, see								
	compliance records in back of this logbook.								
	Lubricated L16 Motor Gearbox & L16 Actuator Gearbox.								
	Serviced Anti. Ice reservoir. SI 0957 C/W on Fuel Vent								
	Hose in outboard wing leading Edge Fuel Cells. Replaced								
	Landing Gear light bulb. Replace in Landing light.								
	Replaced 10 ea instrument flood light bulbs. Replaced								
	RH Main brake pads. Replaced LH Main Tire with new 6.50 &								
	6 PR 600year. Replaced L16 Motor brushes. Charged								
	batteries & serviced same. CONTINUED NEXT PAGE								
TOTALS FORWARD									
TOTALS TO DATE									

REMARKS

DATE	INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS
	Adjusted LH & RH Main outbd doors. Serviced all L16 struts.
	AD's checked thru 78.04 index.
"I CERTIFY THAT THIS Aircraft HAS BEEN INSPECTED IN ACCORDANCE WITH 100 Hour INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION." Beach 24. 118662D	
DATE NOV 27	SIGNATURE [Signature]
*CERTIFICATE DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER 28734 CENTRAL FLYING SERVICE LITTLE ROCK, ARK. REPAIR STA. CERT. NO. 2818	
CONTINUED NEXT PAGE	

FLIGHT LOG

DATE	NATURE OF FLIGHT	No. of Pass	TIME OF FLIGHT		TIME IN AIR		Miles Flown	REPAIRS - ADJUSTMENTS - REMARKS	SIGNATURE	LICENSE NUMBER
			Up	Down	Hours	Min				
11/31/78	Hourmeter	95.1	747	1885.3	hrs.					
	RH oil Temp erratic. Replaced with 3 in 1 Gauge (OHD) Type 22-804-032-11 SIN 240118. Adjusted throttle switch. Repaired subpanel lights. Repaired foot light on Hourmeter. Replaced LH brake disk & pads. Adjusted LH prop. control.									
CERTIFICATE DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER 29633 DATE 11/31/78 SIGNATURE <i>James H. Smith</i> CENTRAL FLYING SERVICE LITTLE ROCK, ARK. REPAIR STA. CERT. NO. 3818										
TOTALS FORWARD										
TOTALS TO DATE										

REMARKS

DATE	REMARKS
11/30/78	Hourmeter 137.9 747 1928.1 hrs. C/W recurring inspections: AD 26.07.12, 520652. 280 Raw I & O 246-152, see compliance records in back of this logbook. Repaired ground wire for Rwing Nav. Replaced Rear Rotating beacon. Replaced bolt on aileron trim tab to adjust play. Serviced batteries. Replaced RH brake lining. Replaced O-rings on RH wheel cylinder. Replaced RH brake disk. Serviced LH & RH main struts & nose strut. Lubricated Flap motor gearbox & Flap Actuator. AD's checked thru 78-16 index.
PI CERTIFY THAT THIS Aircraft HAS BEEN INSPECTED IN ACCORDANCE WITH 100 Hour #1 INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION. Date 11/30/78 SIGNATURE <i>James H. Smith</i> CENTRAL FLYING SERVICE LITTLE ROCK, ARK. REPAIR STA. CERT. NO. 3818	

REMARKS	
INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS	
DATE	
Mar 9 '79	Hourmeter 303.8 TAT 20940 hr.
	C/W AD 79.05.02 on Li502 EIT Battery. Found A/C equipped with EIT Type ecc, Model CIR-10 S/M 4079. Removed EIT battery from A/C.
PERMITT DETAILS ARE ON FILE AT THIS OFFICE UNDER JOB NUMBER 13813	
DATE	SIGNATURE
Mar 9 '79	<i>Thomas M. Smith Jr.</i>
CENTRAL FLYING SERVICE LITTLE ROCK, ARK.	
REPAIR STA. CERT. NO. 3818	
Mar 30 '79	Hourmeter 330.6 TAT 21220.8 hrs.
	C/W recurring inspections: AD 76-07-12, SI's 0632-280 & 0846-152, see compliance records in A/C Maintenance Record. SI 0930 Rev I on replacement of stiff pad in wing tips, N/A, that A/C does not have wet wing tip. SI 0990 on FS 257.6 & 271.92 inspection C/W by installing KTS 55-4030-55 S/M 162, inspection N/A.

FLIGHT LOG

DATE	NATURE OF FLIGHT	No of Pass	TIME OF FLIGHT	TIME IN AIR		Miles Flown	REPAIRS - ADJUSTMENTS - REMARKS	SIGNATURE	LICENCE NUMBER
				Up	Down				
	Replaced Taxi light wire. Repaired grounding wire on RH wing Nav. light. Replaced fuse for fwd overhead light. Repaired sun visor support. Repaired electrical wiring on micro switch for gear warning horn. Repaired broken ground wire on alternator. Adjusted cowling flap motor (LH). Repaired broken wire for LH wing fuel vent heat. Replaced rivet in bottom of LH wing. Replaced RH rib leading edge 40 gal Fuel Cell with P/N 58-380030-8 RH. SIN 78-65900 KIT 60-9002-25 SIN too. Replaced overhead light & vent Assy. Repaired hinge cowling RH outboard. Added 1/2 gal. Deice fluid. Replaced both light bulbs on bottom Rotating Beacon.								
TOTALS FORWARD									
TOTALS TO DATE									

CONTINUED NEXT PAGE

REMARKS

DATE	INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS	REMARKS
	Adjusted clearance on LH RH elevator trim tabs same work on aileron trim tabs. Replaced rubber seal at base of stabilizer. Serviced shimmy dampener with fluid. Replaced LH Main Tire with new 650x2 6 ply 620. Replaced LH Main brake disk, lining, O-ring & piston. Repaired RH Brake & disk. Performed lubrication & servicing as per Beech Manual. Adjusted thru 79-06 inder.	
	INSPECTION IN ACCORDANCE WITH 100 Hour Annual	
	INSPECTION WAS DETERMINED TO BE IN AIRWORTHY CONDITION.	
	DATE 11/16/25 SIGNATURE [Signature]	
	CENTRAL FLYING SERVICE LITTLE ROCK, ARK	
	REPAIR STA. CERT. NO. 3818	

FLIGHT LOG

DATE	NATURE OF FLIGHT	No of Pass	TIME OF FLIGHT	TIME IN AIR		Miles Flown	REPAIRS - ADJUSTMENTS - REMARKS	SIGNATURE	LICENSE NUMBER
				Up	Down				
APR 23 78	Hourmeter	3570	TOT	2,147.2	hrs				
	Replaced LH & RH						gear doors with PIN 35-815055.159.		
PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER 31300 DATE APR 16 78 SIGNATURE Thomas H. Smith Jr. CENTRAL FLYING SERVICE LITTLE ROCK, ARK. REPAIR STA. CERT. NO. 3818									
APR 16 78	Hourmeter	370.4	TAT	2,160.6	hrs				
	Repaired survivor.						serviced LH strut with hydraulic & nitrogen. Adjusted stall warning switch. Adjusted RH aileron trim tab. Installed new throttle cable, adjusted throttle movement. Anti-skid painted assist step. Fabricated & installed new manifold pressure line.		
TOTALS FORWARD									
CONTINUED NEXT PAGE									
TOTALS TO DATE									

REMARKS

DATE	INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS
APR 23 78	Adjusted mixture control cable. Fabricated & installed new aluminum drain line. Tightened propeller nut. Stop drilled crack in cowling flap.
PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER 31325 DATE APR 16 78 SIGNATURE Thomas H. Smith Jr. CENTRAL FLYING SERVICE LITTLE ROCK, ARK. REPAIR STA. CERT. NO. 3818	
APR 16 78	Hourmeter 4210 TAT 2,211.2 hrs.
	CLW recurring inspection: AD 78-05-06, STS 0518-035, 0632.
	28040946.152 see compliance record in ARC Maint Record.
	CLW 500 Communique 480 on L/R. chafing fuel line. Repaired rubbing fairing on top side of LH wing. Performed lubrication & servicing as per Beech Manual.
CONTINUED NEXT PAGE	

FLIGHT LOG

DATE	NATURE OF FLIGHT	No of Pass	TIME OF FLIGHT		TIME IN AIR		Miles Flown	REPAIRS - ADJUSTMENTS - REMARKS	SIGNATURE	LICENSE NUMBER
			Up	Down	Hours	Mins				
	AD's checked thru 79-11 index.									
	Aircraft <u>100 Hour #1</u> <u>Has been</u> <u>weighed Ate</u> <u>New Empty WT: 3624.85</u>									
	Inspected in accordance with <u>100 Hour #1</u> <u>New Empty CG: 1,715.60</u>									
	Inspected and was determined to be in airworthy condition."									
	Bred 56, 118666E									
	PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER <u>31554</u>									
	DATE <u>Jan 22 79</u> SIGNATURE <u>Thomas W. Smith</u>									
	CENTRAL FLYING SERVICE LITTLE ROCK, ARK									
	REPAIR STA. CERT. NO. 3818									
	Tachometer 457.1 TAT 2297.3 hr									
	Lubricated lower rotating Beacon motor Replaced upper rotating Beacon with PIN 40-0100-1, S/N 665.									
	PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER <u>31779</u>									
	DATE <u>Jan 27 79</u> SIGNATURE <u>Thomas W. Smith</u>									
	CENTRAL FLYING SERVICE LITTLE ROCK, ARK									
	REPAIR STA. CERT. NO. 3818									
TOTALS FORWARD										
TOTALS TO DATE										

REMARKS

DATE	REMARKS
Jan 27 79	Houmometer 498.5 TAT 2,288.7 hr.
	Lubricated door rod assy. Installed all new brake linings on both LH & RH sides.
	PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER <u>32027</u>
	DATE <u>Jan 25 79</u> SIGNATURE <u>Thomas W. Smith</u>
	CENTRAL FLYING SERVICE LITTLE ROCK, ARK
	REPAIR STA. CERT. NO. 3818
Jan 18 79	Houmometer 517.8 TAT 2308.0 hr.
	ELW recurring inspections: AD 76-07-12, SI's 0632-280, 0824-109, see compliance records in Ate Maint Record. Replaced RH Ice light bulb, RH Fuel cap O-ring. Removed compass for RH & replaced. Replaced gyro light bulb. Replaced 800 light bulb on front lights. Replaced Taxi light bulb. Replaced fuel buddeon upper Beacon. Replaced wiring boots on L/E retracted both sides.
CENTRAL FLYING SERVICE LITTLE ROCK, ARK	

FLIGHT LOG

DATE	NATURE OF FLIGHT	No. of Pass.	TIME OF FLIGHT	TIME IN AIR	Miles Flown	REPAIRS - ADJUSTMENTS - REMARKS	SIGNATURE	LICENSE NUMBER
			Up	Down	Hours	Min.		
	Performed gear operational check. Adjusted 114 cable tension.							
	Performed lubrication & servicing as per Beech Plan.							
	AD's checked then 29-18 in day.							
	I CERTIFY THAT THIS		Aircraft		HAS BEEN			
	INSPECTED IN ACCORDANCE WITH		100-Hour #9		DATE 9/19/79 SIGNATURE <i>Donna Whitte</i>			
	INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION."					CENTRAL FLYING SERVICE LITTLE ROCK, ARK.		
	Beech IV, 1186625					REPAIR STA. CERT. NO. 3818		
	Hourmeter 551.2 TAT 2,341.4 hrs.							
	Installed KEA-127 Blind Encoder.							
	Made up FAA Form 377, update weight & Balance.							
TOTALS FORWARD	CONTINUED NEXT PAGE							
TOTALS TO DATE								

REMARKS

DATE	INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS
	New Empty weight 3625.4
	New Empty CG 76.8
	New useful load 1,774.6
	update Equipment list.
	Performed static system check. No leak found.
	PERMIT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER 14673 & 32555
	DATE 10/8/79 SIGNATURE [Signature] CENTRAL FLYING SERVICE LITTLE ROCK, ARK.
	REPAIR STA. CERT. NO. 3818
	Hourmeter 623.0 TAT 2413.2 hr
	CLW recurring inspections: AD 76-07-12, ST's 0632-280, DSU 615, ST's 0390 Rev 1 (Rec. 100hr) & 1077 (initial Insp), see compliance records in A/C Maintenance Record. Replaced bushing in cow
	CONTINUED NEXT PAGE

FLIGHT LOG

DATE	NATURE OF FLIGHT	No. of Pass.	TIME OF FLIGHT		TIME IN AIR		Miles Flown	REPAIRS - ADJUSTMENTS - REMARKS	SIGNATURE	LICENSE NUMBER
			Up	Down	Hours	Min.				
								flap actuator (LH) & dashed actuator support arm. straightened & stop drilled crack on LH aileron inboard end. Replaced 3 broken screws on lower lift wing access panel. Replaced bulbs in lower gear position indicator, & in aileron trim tab indicator, & 41C wing (Red) position. Replaced switch for door courtesy light. Replaced rotating beacon light bulb & dehydrated gear top & bottom.		
								Replaced Main wheel Bearings. Replaced RH Main Tire & tube. Replaced both brake calipers & bleed system. Replaced all brake linings with new parts. Performed lubrication & servicing as per Beech Manual.		
CONTINUED NEXT PAGE										
TOTALS FORWARD										
TOTALS TO DATE										

REMARKS

AD-5 checked thru 79-24 index.

AD-5 checked thru 79-24 index.

INSPECTION - MAINTENANCE - REPAIRS - ALTERATIONS

I CERTIFY THAT THIS Aircraft #3 Annual HAS BEEN 32259

INSPECTED IN ACCORDANCE WITH 100 Hour Annual DATE DEC 13 79 SIGNATURE John W. Smith

INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION. CENTRAL FLYING SERVICE LITTLE ROCK, ARK. Repair STA. CERT. NO. 3818

Good 24-118662E

Hourmeter 630.2 TAT 2420.4 hr.

Replaced instrument air filter.

PERTINENT DETAILS ARE ON FILE AT THIS AGENCY UNDER JOB NUMBER 32259

DATE DEC 17 79 SIGNATURE James H. Smith

CENTRAL FLYING SERVICE LITTLE ROCK, ARK.

REPAIR STA. CERT. NO. 3818

RADIO INSPECTION AND REPAIR

[illegible]

RADIO INSPECTION AND REPAIR

[illegible]