

TOTAL brought forward from previous page



Freedom Aviation
310 Hangar Road
Lynchburg, VA 24502
(434) 237-3342
CRS# BGSR439C


Date: 2/24/2023; Aircraft: N583PU; Type: SR20; S/N: 2043; Tach: 5560.5; WO#: F23-1197

Airframe Entries

Customer complaint that the GMA347 audio panel is showing a GMA config error and there are multiple database errors shown on the displays. Ramp checked and verified the complaint. Entered the configuration mode of the Perspective system and performed a re-configuration of the GMA347 audio panel. The audio panel config service required message is no longer present. Performed a system database update of all the supplemental databases. Updated the Navigation database to the current cycle. There are no longer any messages on the Perspective displays. The Perspective Avionics system ramp checked good per Cirrus SR20 AMM 34-00.

Maintenance Release

The aircraft and/or component(s) as listed above was repaired in accordance with current Federal Aviation Regulations. Pertinent details are on file at this repair station.

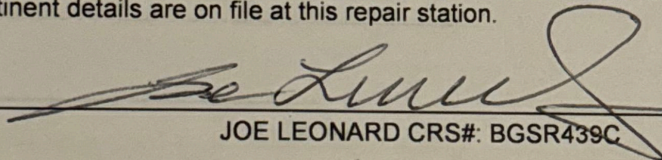

JOE LEONARD CRS#: BGSR439C



310 Hangar Road
Lynchburg, VA 24502
434-237-7002
CRS# BGSR439C

Date: 9/14/2023; Aircraft: N583PU; Type: Cirrus SR20; S/N: 2043; Hobbs: 7397.50;
Tach: 5622.70; Total Time: 5622.70

Shop Order #: F23-1996

Airframe Entry

Removed nose wheel, deflated tire and separated wheel halves. Found inner tube to be pinched and leaking. Replaced inner tube with P/N 097-908-0 inflated tire to 40 PSI and installed nose wheel onto aircraft. IAW Cirrus SR-20 AMM Sec. 32-41.

Maintenance Release

The aircraft or appliance identified above was repaired in accordance with current Federal Aviation Regulations. Pertinent details are on file at this Repair Station

Signed: 

CRS# BGSR439C