

# Maintenance Discrepancy Form

Work Order No.: Sky 0006	Item No.	Acft Serial No. & Registration BB1046 / N146 LC	AFTT 9763.9	AFTC 10855	Date Opened 21 May 2018
Discrepancy  AD 2003-13-16  Inspect AFT PRESSURE BulkHEAD					Airworthiness Item <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No Authorization to Work / Entered By Danie van der Berg
Recommended Repair Procedure Inspection					Parts Req'd <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No
<b>Resolution</b>					
Corrective Action  AD 2003-13-16. AFT PRESSURE BulkHEAD Inspected for Scoring and Manufacturing Defects.  No Defects Noted During This Inspection.					
Work accomplished in reference to: AD 2003-13-16					
Technician Sign & Date D. van der Berg 24 MARCH 2021		Inspector Sign & Date G. L. Croff 24 MARCH 2021		2nd Inspection Required? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No 2nd Inspector Sign & Date N/A.	

All installed parts must have proper documentation. Enter parts information on reverse.

A/C REG	WO NO.	CHECK COMPLETED	A/C TSN	A/C CSN	A/C TYPE
9J-DOC	2756	PHASE IV C OF A INSPECTION	9246:50	10314	SUPER KING AIR B200
COMPONENT DESCRIPTION		PART NUMBER		SERIAL NUMBER	
AIRFRAME		SUPER KING AIR B200		BB1046	

DETAILS OF WORK

Complied with PHASE IV

Complied with service check in accordance with super king Air B200.

AIRWORTHINESS DIRECTIVE:

AD-2003-13-16 AFT PRESSURE BULK HEAD  
AD 97-23-17 PNEUMATIC TUBINGS  
AD 97-06-06 PILOT AND COPILOT CHAIRS LOCKING PINS  
AD 97-25-03 OUTFLOW SAFETY VALVE  
AD 96-09-13 AFM - ICING  
AD 87-04-24 ELEVATOR TRIM CABLE SYSTEM  
FIRST AID KITS  
PORTABLE FIRE BOTTLES CREW AND CABIN  
ATC TRANSPONDER  
ALTIMETER  
COMPASS SWING  
A.S.I

ALL APPLICABLE AD'S COMPLIED WITH

CERTIFIES THAT UNLESS OTHERWISE SPECIFIED, THE WORK DESCRIBED ABOVE WAS ACCOMPLISHED IN ACCORDANCE WITH CURRENT REGULATIONS AND IN RESPECT TO THAT WORK THE AIRCRAFT/ AIRCRAFT COMPONENT IS CONSIDERED APPROVED FOR RETURN TO SERVICE.

Date: 23/06/2014 Sign: [Signature]

Licence or other authorization no: 0934



This CRMA constitutes an official LOG BOOK entry and must be affixed in the Appropriate LOG BOOK



# Executive Air (Pvt) Ltd

FORM EXEC H021

P.O. Box EH96  
Emerald Hill  
Harare  
Zimbabwe

Charles Prince Airport

## Log Book Certificate

Telephone: 304639  
302248  
Fax: 304328  
E-M: exair@icon.co.zw

Job No. 1015

Page 1 of 1

Aircraft Type	Registration	Engine Type	Serial Number
KING AIR B200	Z-APG	P & W PT6A-42	BB1046

### AIRFRAME.

1. Mandatory Modification State checked as follows:

R.A.C AD's:

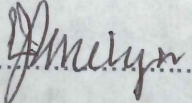

89-19-04 R1 Wing Fuel Bay Skin Panels.  
(SB No.2040 Rev III)

Last inspected at 6879.0  
hrs on 31/12/2003 and  
reinspected at 7074.2 hrs  
on 29/08/2003 - no defects  
indicated therefore found  
satisfactory.

2003-13-16 AFT Pressure Bulkhead of the  
Fuselage.  
(SB No.53-3513 Rev I)

Repair doubler from 2024-  
T3 manufactured and fitted  
to pressure bulkhead with  
PRC compound and rivetted  
in position with MS20470  
AD4 rivets. Resealed with  
PRC and all panels refitted.

Note: I hereby certify that in carrying out the inspection, overhaul, repair, replacement, modification, specified above, all the conditions and requirements of the Air Navigation Regulations for the time being in force which are applicable thereto have been complied with

SIGNED:  LICENCE:  & CATEGORY: ABCX..DATE: 29/08/03

[illegible]