

Executive Propellers *inc.*

16146 COVELLO STREET • VAN NUYS, CALIFORNIA 91406

(818) 779-7767 • FAX (818) 779-0848

FAA CRS # EU6R595N



PROPELLER LOGBOOK

PROPELLER MAINTENANCE RECORD

Propeller Manufacturer: HARTZEL

Hub Model No. HC-C2YK-1BF

Hub Serial No. CH32232A

Blade Model No. F7666A-2

Blade Serial No. 1 E15186

No. 2 E15191

No. 3 4 4 4

No. 4 4 4 4

No. 5 4 4 4

High 30.0° Low 14.0° PITCH RANGE Feather 2 Reverse 2

Governor Manufacturer: _____

Governor Model No. _____

Governor Serial No. _____


Maximum Hours or Service Life between overhaul recommended by Mfg. 2000 Hrs. or SIX years, whichever occurs first.

CUSTODY RECORD

Owner _____	Date Rec'd. _____
Owner _____	Date Rec'd. _____
Owner _____	Date Rec'd. _____
Owner _____	Date Rec'd. _____

Make/Model	Serial #
Aircraft Installed On: _____	_____
_____	_____
_____	_____
_____	_____

OVERHAUL RECORD

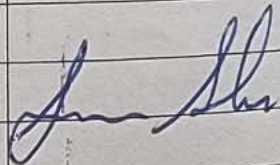No.	Date	Repair Station and No.	Signature
	10-21-2010	Executive Propellers, Inc. FAA CRS # EU6R595N 16146 Covello Street, Van Nuys CA 91406 (818) 779-7767	

DATE

10-21-2010

1. Approving National Aviation Authority/Country: FAA/UNITED STATES		2.		3. Form Tracking Number: 010-331	
4. Organization Name and Address: EXECUTIVE PROPELLERS, INC. 16146 COVELLO STREET VAN NUYS, CA 91406 CRS # EU6R595N				5. Work Order/Contract/Invoice Number: W.O. 010-331	
6. Item: 1	7. Description: HARTZELL PROPELLER	8. Part Number: HC-C2YK-1BF/F7666A-2	9. Eligibility: * N/A	10. Quantity: 1	11. Serial/Batch Number: ASSY: S/N CH32232A BLADE S/N'S E15186 E15191
12. Status/Work: OVERHAUL					
13. Remarks PROPELLER OVERHAULED I.A.W. MFGS. MANUALS 113B, 133C & 202A. PROPELLER ASSEMBLED. FUNCTIONALLY BENCH CHECKED AND ANGLES SET TO MFGS. SPECS. 14.0 DEGREES LOW PITCH : 30.0 DEGREES HIGH PITCH. S/B'S ALL REVIEWED & COMPLIED WITH @ 114D, 118F, 138I, 165E, 226 REV. 1, 238, 259, 61-226r1, 227rev. 4, 269. S/L'S ALL REVIEWED & COMPLIED WITH @ 61-61, 69, 154, 165, 177, 184, 213, 223, 226 rev. 1, 229. A.D. 2009-22-03 IN COMPLIANCE @ HUB S/N RENDERS THIS A.D. - N/A. A.D. 2007-26-09 IN COMPLIANCE @ ACCOMPLISHED INSPECTIONS/REWORK PER MFGS. S/B 118F. BLADE SHANKS "COMPRESSION ROLLED" AT THIS TIME. REQUIRED AT EACH OVERHAUL. A.D. 2003-13-17 - N/A TO THIS PROPELLER @ ASSEMBLY S/N. A.D. 2005-14-11 - N/A TO THIS PROPELLER - PAST RECORDS. NO OTHER AIRWORTHINESS DIRECTIVES APPLICABLE TO THIS PROPELLER THRU THIS DATE @ 10-21-2010.					
14. Certifies the items identified above were manufactured in conformity to: <input type="checkbox"/> Approved design data and are in a condition for safe operation. <input type="checkbox"/> Non-approved design data specified in Block 13.			19. <input checked="" type="checkbox"/> 14 CFR 43.9 Return to Service <input type="checkbox"/> Other regulation specified in Block 13 Certifies that unless otherwise specified in Block 13, the work identified in Block 12 and described in Block 13 was accomplished in accordance with Title 14, Code of Federal Regulations, part 43 and in respect to that work, the items are approved for return to service.		
15. Authorized Signatures		16. Approval/Authorization No.:		20. Authorized Signature	
17. Name (Typed or printed):		18. Date (m/d/y):		22. Name (Typed or Printed): JUAN SALAIS	
				21. Approval/Certificate No.: EU6R595N	
				23. Date (m/d/y): OCTOBER 21, 2010	
User/Installer Responsibilities					
It is important to understand that the existence of this document alone does not automatically constitute authority to install the part/component/assembly.					
Where the user/installer performs work in accordance with the national regulations of an airworthiness authority different than the airworthiness authority of the country specified in Block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts parts/components/assemblies from the airworthiness authority of the country specified in Block 1.					
Statements in Blocks 14 and 19 do not constitute installation certification. In all cases, aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.					
FAA Form 8130-3 (6-01) *Installer must cross-check eligibility with applicable technical data. Reproduced by Avianext, Inc. NSN: 0052-00-012-9005					

DATE

TACH

10-21-2010

S.P.

Juan Salais

DATE	TACH TIME	DESCRIPTION OF WORK	SIGNATURE
10-21-2010	S.P.O. H.	<p>PROPELLER COMPLETELY OVERHAULED. I.A.W. HARTZELL SERVICE MANUAL # 1135, 133C 202A. ALL A.D.'s AND HARTZELL S.E.'s AND S.I.'s COMPLIED WITH TO DATE. <i>Permanently Delivered</i> <i>of this overhaul as per order</i> <i>W.O. 010-331 at</i> <i>the following repair facility:</i> Executive Propellers, Inc. FAA CRS # EU6R595N 16146 Covello Street, Van Nuys CA 91406 (818) 779-7767</p>	
			<i>Sam Ellis</i>

Jun 21

DESCRIPTIONS OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS

DATE	TACH TIME	DESCRIPTION OF WORK	SIGNATURE
------	-----------	---------------------	-----------

Aircraftsman

7000 Merrill Ave
Hangar A480/Box 100
Chino, CA 91710

Chino Airport
(909) 393-0884
(909) 393-0494 FAX

N-Number: N7164V
Prop Model No: HC-C2YK-1BF
Prop Serial No: CH32232A

Date: 11/10/10
Tach: 3535.23
SOH: 0.00

1. Inspected this propeller IAW 100 hour/Annual Inspection guidelines, checked all AD's thru 2010-23 and find it to be Airworthy.
2. Installed this propeller IAW Mooney and Hartzell Service Manuals.
3. Installed overhauled propeller governor, model B210345, serial number 2346019 by American Propeller Service, Redding CA, under WO # 12850-10-2010.

Mark Wilson A&P178364413

Mark Wilson

Propeller

FOOTHILL AIRCRAFT
UPLAND, CA 91786 FA
I CERTIFY THAT TH
ACCORDANCE W/ A
MAINTENANCE MAN
SERVICE DETAILS OF
FACILITY.

WO# 12026 D
T.T. A/C 3491.8
NAME

DESCRIPTIONS OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS

FOOTHILL AIRCRAFT SALES & SERVICE, INC. CABLE AIRPORT
UPLAND, CA 91786 FAA APPROVED REPAIR STATION AJ4R052M
I CERTIFY THAT THIS PROPELLER HAS BEEN INSPECTED IN
ACCORDANCE W/ A ANNUAL INSPECTION PER THE MFG'S
MAINTENANCE MANUAL AND IS APPROVED FOR RETURN TO
SERVICE. DETAILS OF THIS INSPECTION ARE ON FILE AT THIS
FACILITY.

WO# 12026 DATE 12-9-2011 TAC 3491.8
T.T. A/C 3491.8 PROPELLER
NAME MW. A.

N OF WORK	SIGNATURE

PROP MODEL:
HC-C2YK-1BF
PROP S/N: CH32232A
REG. NO: 7164V
WORK ORDER:
14192-01-2013

Foothill Aircraft Sales & Service, Inc.

Repair Station No. AJ4R052M
1749 W 13Th St
Upland, CA 91786
Phone: 909-985-1977

DATE: 1/18/2013
A/C TSN: 3555.7
PROP TT: 20.47
TSPOH: 20.47
TACH: 3555.7

Prop Entries

(3) COMPLIED WITH ANNUAL / 100 HOUR ON PROPELLER

Maintenance Release

I certify that the PROPELLER on 7164V was inspected in accordance with an 100hr./Annual inspection per the manufactoures maintenance manual and current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service. Pertinent details of the repair are on file at this repair station under Work Order No. 14192-01-2013, Dated 1/18/2013.

DATE: 1/18/2013

SIGNED:

Don Wade
Certified Repair Station No. AJ4R052M

Work Order: 14192-01-2013

Printed by EBis 3 (datcomedia.com)

DESCRIPTIONS OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS

PROP MODEL:
HC-C2YK-1BF
PROP S/N: CH32232A
REG. NO: 7164V
WORK ORDER:
14830-01-2014

Foothill Aircraft Sales & Service, Inc.

Repair Station No. AJ4R052M
1749 W 13Th St
Upland, CA 91786
Phone: 909-985-1977

DATE: 2/11/2014
A/C TSN: 3615.4
PROP TT: 80.17
TSPOH: 80.17
TACH: 3615.4

DATE

Prop Entries


(3) C/W ANNUAL/100HR INSPECTION ON THIS PROPELLER IAW FAR 43 APPENDIX D USING MOONEY M20F M.M CHAPTER 5 INSPECTION CHECKLIST AS A GUIDE. ADs CHECKED THROUGH 02-2014.

Maintenance Release

I certify that the PROPELLER on 7164V was inspected in accordance with an 100hr./Annual inspection per the manufactures maintenance manual and current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service. Pertinent details of the repair are on file at this repair station under Work Order No. 14830-01-2014, Dated 2/11/2014.

DATE: 2/11/2014

SIGNED:

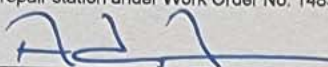

Work Order: 14830-01-2014

Adrian Arias
Certified Repair Station No. AJ4R052M

Printed by EBis 3 (datcomedia.com)

IATURE

PROP MODEL:
HC-C2YK-1BF
PROP S/N: CH32232A
REG. NO: 7164V
WORK ORDER:
15445-03-2015

Foothill Aircraft Sales & Service, Inc.

Repair Station No. AJ4R052M
1749 W 13Th St
Upland, CA 91786
Phone: 909-985-1977

DATE: 4/2/2015
A/C TSN: 3676.55
PROP TT: 141.32
TSPOH: 141.32
TACH: 3676.55

Prop Entries

(3) C/W ANNUAL/100HR INSPECTION ON THIS PROPELLER IAW FAR 43 APPENDIX D USING MOONEY M20F M.M CHAPTER 5 INSPECTION CHECKLIST AS A GUIDE. ADs CHECKED THROUGH 04-2015.

Maintenance Release

I certify that the Engine and/or component(s) on 7164V was repaired and inspected in accordance with a Annual/100HR. Inspection per the manufactures maintenance manual and current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service. Pertinent details of the repair are on file at this repair station under Work Order No. 15445-03-2015, Dated 4/2/2015.

DATE: 4/2/2015

SIGNED:



Work Order: 15445-03-2015

Adrian Arias
Certified Repair Station No. AJ4R052M

Printed by EBis 3 (datcomedia.com)

PROP
HC-C2Y
PROP S
REG. N
WORK
16143-0

Prop


(3) C/
MOON
07-20

Mainte
I certify
mainte
Pertine

DATE:

DESCRIPTIONS OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS

PROP MODEL:
HC-C2YK-1BF
PROP S/N: CH32232A
REG. NO: 7164V
WORK ORDER:
16143-06-2016



Foothill Aircraft Sales & Service, Inc.

Repair Station No. AJ4R052M
1749 W 13Th St
Upland, CA 91786
Phone: 909-985-1977

DATE: 7/13/2016
A/C TSN: 3718.27
PROP TT: 183.04
TSPOH: 183.04
TACH: 3718.27

SIGNATURE

Prop Entries

(3) C/W ANNUAL/100HR INSPECTION ON THIS PROPELLER IAW FAR 43 APPENDIX D USING MOONEY M20F M.M CHAPTER 5 INSPECTION CHECKLIST AS A GUIDE. ADs CHECKED THROUGH 07-2016.

Maintenance Release

I certify that the PROPELLER on 7164V was inspected in accordance with an 100hr./Annual inspection per the manufacturer's maintenance manual and current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service. Pertinent details of the repair are on file at this repair station under Work Order No. 16143-06-2016, Dated 7/13/2016.

DATE: 7/13/2016

SIGNED:


Joe Caliva

Certified Repair Station No. AJ4R052M

Work Order: 16143-06-2016

Printed by EBis 3 (datcomedia.com)


**DESCRIPTIONS OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS**

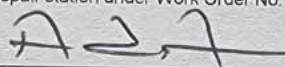DATE	DESCRIPTION	DATE
	<div style="display: flex; justify-content: space-between;"> <div style="width: 30%;"> PROP MODEL: HC-CZYK-18F PROP S/N: CH32232A REG. NO: 7164V WORK ORDER: 16874-08-2017 </div> <div style="width: 35%;"> Foothill Aircraft Sales & Service, Inc. Repair Station No. AJ4R052M 1749 W 13Th St Upland, CA 91786 Phone: 909-985-1977 </div> <div style="width: 30%;"> DATE: 8/25/2017 A/C TSN: 3738.95 PROP TT: 203.72 TSPOH: 203.72 TACH: 3738.95 </div> </div>	
	Prop Entries (3) C/W ANNUAL/100HR INSPECTION ON THIS PROPELLER IAW FAR 43 APPENDIX D USING MOONEY M20F M.M CHAPTER 5 INSPECTION CHECKLIST AS A GUIDE. ADS CHECKED THROUGH 07-2017.	
	Maintenance Release I certify that the PROPELLER on 7164V was inspected in accordance with an 100hr./Annual inspection per the manufacturer's maintenance manual and current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service. Pertinent details of the repair are on file at this repair station under Work Order No. 16874-08-2017, Dated 8/25/2017.	
	<div style="display: flex; justify-content: space-between;"> <div> DATE: 8/25/2017 </div> <div> SIGNED:  </div> <div> Work Order: 16874-08-2017 </div> </div>	
	<div style="display: flex; justify-content: space-between;"> <div> Adrian Arias Certified Repair Station No. AJ4R052M </div> <div> Printed by EBis 3 (datcomedia.com) </div> </div>	

DESCRIPTIONS OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS

D

PROP MODEL:
HC-C2YK-1BF
PROP S/N: CH32232A
REG. NO: 7164V
WORK ORDER:
17580-10-2018



Foothill Aircraft Sales & Service, Inc.

Repair Station No. AJ4R052M
1749 W 13Th St
Upland, CA 91786
Phone: 909-985-1977

DATE: 11/3/2018
A/C TSN: 3754.3
PROP TT: 219.07
TSPOH: 219.07
TACH: 3754.3

SIGNATURE

Prop Entries

(3) C/W ANNUAL/100HR INSPECTION ON THIS PROPELLER IAW FAR 43 APPENDIX D USING
MOONEY M20F M.M CHAPTER 5 INSPECTION CHECKLIST AS A GUIDE. ADs CHECKED THROUGH
11-2018.

Maintenance Release

I certify that the PROPELLER on 7164V was inspected in accordance with an 100hr./Annual inspection per the manufactures
maintenance manual and current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service.
Pertinent details of the repair are on file at this repair station under Work Order No. 17580-10-2018, Dated 11/3/2018.

DATE: 11/3/2018

SIGNED:


Adrian Arias
Certified Repair Station No. AJ4R052M

Work Order: 17580-10-2018

Printed by EBis 3 (datcomedia.com)

**DESCRIPTIONS OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS**

PROP MODEL:
HC-C2YK-1BF
PROP S/N: CH32232A
REG. NO: 7164V
WORK ORDER:
18196-12-2019



Foothill Aircraft Sales & Service, Inc.

Repair Station No. AJ4R052M
1749 W 13Th St
Upland, CA 91786
Phone: 909-985-1977

DATE: 12/20/2019
A/C TSN: 3778.8
PROP TT: 243.57
TSPOH: 243.57
TACH: 3778.8

Prop Entries

(3) C/W ANNUAL/100HR INSPECTION ON THIS PROPELLER IAW FAR 43 APPENDIX D USING MOONEY M20F M.M CHAPTER 5 INSPECTION CHECKLIST AS A GUIDE. ADS CHECKED THROUGH 12-2019.

Maintenance Release

I certify that the PROPELLER on 7164V was inspected in accordance with an 100hr./Annual inspection per the manufacturer's maintenance manual and current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service. Pertinent details of the repair are on file at this repair station under Work Order No. 18196-12-2019, Dated 12/20/2019

DATE: 12/20/2019

SIGNED:

Ralph Gouda
Certified Repair Station No. AJ4R052M

Work Order: 18196-12-2019

Printed by EBis 3 (datcomedia.com)

SIGNATURE

PROP MODEL:
HC-C2YK-1BF
PROP S/N: CH32232A
REG. NO: 7164V
WORK ORDER:
18887-01-2021

Prop Entries

(3) C/W ANNUAL/100HR I
MOONEY M20F M.M CHA
01-2021.

Maintenance Release

I certify that the PROPELLER
maintenance manual and curre
Pertinent details of the repair a

DATE: 1/28/2021

PROP MODEL:
HC-CZYK-1BF
PROP S/N: CH32232A
REG. NO: 7164V
WORK ORDER:
18687-01-2021



Foothill Aircraft Sales & Service, Inc.

Repair Station No. AJ4R052M
1749 W 13Th St
Upland, CA 91786
Phone: 909-985-1977

DATE: 1/28/2021
A/C TSN: 3812.31
PROP TT: 277.08
TSPOH: 277.08
TACH: 3812.31

Prop Entries

(3) C/W ANNUAL/100HR INSPECTION ON THIS PROPELLER IAW FAR 43 APPENDIX D USING MOONEY M20F M.M CHAPTER 5 INSPECTION CHECKLIST AS A GUIDE. ADs CHECKED THROUGH 01-2021.

Maintenance Release

I certify that the PROPELLER on 7164V was inspected in accordance with an 100hr./Annual inspection per the manufacture's maintenance manual and current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service. Pertinent details of the repair are on file at this repair station under Work Order No. 18687-01-2021, Dated 1/28/2021.

DATE: 1/28/2021

SIGNED:

Abraham Abel
Certified Repair Station No. AJ4R052M

Work Order: 18687-01-2021

Printed by EBis 3 (dalcomedia.com)

1 of 1

SIGNATURE

FAA AIRWORTHINESS DIRECTIVES COMPLIANCE RECORD

Year: <u>2010</u>	Total Hours	Complied by the following:
Date: <u>10/21</u>		<u>N/A - propeller records - N/A</u>
A.D. # <u>2003-13-17</u> <u>2005-14-11</u>		Executive Propellers, Inc. FAA CRS # EU6R595N 16146 Covello Street, Van Nuys CA 91406 (818) 779-7767
Next Inspection Due: <u>ONE TIME COMPLIANCE</u>		Signature: <u>[Signature]</u>

Year: <u>2010</u>	Total Hours	Complied by the following:
Date: <u>10/21</u>		<u>Blade Shanks inspected and reworked following S/E 118F and OHA 133C guidelines. Blade Compression rolled at this time. Rechecked at each overhaul.</u>
A.D. # <u>2007-26-09</u>		Executive Propellers, Inc. FAA CRS # EU6R595N 16146 Covello Street, Van Nuys CA 91406 (818) 779-7767
Next Inspection Due: <u>at overhaul</u>		Signature: <u>[Signature]</u>

Year: 2010
Date: 10/21
A.D. #

2009
Next Inspection
at ov

Year: _____
Date: _____
A.D. #

Next Inspection

FAA AIRWORTHINESS DIRECTIVES COMPLIANCE RECORD

Year: <u>2010</u>	Total Hours	Complied by the following:
Date: <u>10/21</u>		
A.D. # <u>2009.22.03</u>		<p>The hub C/S/ CH32232A is A.D. Compliant. <u>No</u> further action required.</p>
Next Inspection Due: <u>at overhaul.</u>		
		<p>Executive Propellers, Inc. FAA CRS # EU6R595N 16146 Covello Street, Van Nuys CA 91406 (818) 779-7767</p>
		Signature: <u>[Signature]</u>
Year: _____	Total Hours	Complied by the following:
Date: _____		
A.D. # _____		
Next Inspection Due: _____		
		Signature: _____

91406

Following
No
Required

6

Year: _____

Date: _____

A.D. # _____

Next Inspection Due: _____

Year: _____

Date: _____

A.D. # _____

Next Inspection Due: _____

To

TrueBlock Shipping Labels
Completely covers everything underneath

5168

AVERY

PROP MODEL:
HC-C2YK-1BF
PROP S/N: CH32232A
REG. NO: 7164V
WORK ORDER:
19260-02-2022



Foothill Aircraft Sales & Service, Inc.

Repair Station No. AJ4R052M
1749 W 13Th St
Upland, CA 91786
Phone: 909-985-1977

DATE: 3/8/2022
A/C TSN: 3825.26
PROP TT: 290.03
TSPOH: 290.03
TACH: 3825.26

Prop Entries

(3) C/W ANNUAL/100HR INSPECTION ON THIS PROPELLER IAW FAR 43 APPENDIX D USING MOONEY M20F M.M CHAPTER 5 INSPECTION CHECKLIST AS A GUIDE. ADs CHECKED

Maintenance Release

I certify that the PROPELLER on 7164V was inspected in accordance with an 100hr./Annual inspection per the manufacturer's maintenance manual and current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service. Pertinent details of the repair are on file at this repair station under Work Order No. 19260-02-2022, Dated 3/8/2022.

DATE: 3/8/2022

SIGNED: 

Adrian Arias
Certified Repair Station No. AJ4R052M

Work Order: 19260-02-2022

Printed by EBis 3 (datcomedia.com)

1 of 1

Signature: _____

Year: _____

Date: _____

A.D. # _____

Next Inspection Due: _____

Year: _____

Date: _____

A.D. # _____

Next Inspection Due: _____

