

OLD



TJ-472.
RH

N-58772

NEW-1084

PROPELLER LOGBOOK

Printed in U.S.A.
May 1983

Owner Name _____

Address _____

Propeller Model 3AF32C511-B

Blade Model G-82NEA-4

Hub Serial No. 840961

Blade Serial No. 1 DJ052

2 EC 427

3 AJ 233

4 _____

INSTALLATION HISTORY

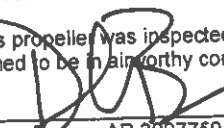
Date	
6-21-90	AMERICAN PROPELLER SERVICE F.A.A. Repair Station No. NO3R717L ☒ / NO3D717L ☐ Redding Municipal Airport, Redding, California, U.S.A. Work accomplished <u>RESEAL: Disassembled, cleaned, visually inspected all parts.</u> <u>Replaced all seals and assembled propeller.</u> <u>Functionally operated propeller on test and stand. Profiled,</u> <u>detailed, safetied and balanced propeller.</u> The aircraft and/or component identified above was repaired and inspected in accordance with current Federal Aviation regulations and is approved for return to service. Pertinent details are on file at this agency under Work Order No. <u>16276</u> Invoice No. <u>26489</u> Dated <u>June 21, 1990</u> Signed <u>J. A. De</u> Authorized Individual
6-22-90	

MAINTENANCE & SERVICE HISTORY

Date	Total Propeller Time THIS MAINTENANCE IS CERTIFIED	Time Since Overhaul	Description Of Work	Authorized Signatures Repairman and Station Certificate Numbers
6/22/90	AIRWORTHY. RETURN TO SERVICE - SIGN	DATE 6-22-90 WO. 500515 T. TIME 616.9	Installed Rescaled propeller.	A/P 569114630 W.H. Cury
	FLIGHTCRAFT Hayward, CA. FAA. A.R.STA. #FCP5831D			
	DATE 7-19-90 TACAR 633.0 TOTAL TIME 633.0 NEW SPON 633.0			
	INSPECTION WAS PERFORMED ON PROPELLER AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION. DETAILS ON W/O 500626F			
	SIGNATURE D. S. G. INSPECTOR, FLIGHTCRAFT, INC./HAYWARD FCP5831D			

NOTE: Enter Compliance With All Applicable FAA A.D. & Factory Service Bulletins On Pages 11 & 12

MAINTENANCE & SERVICE HISTORY

Date	Right Propeller Log Entry	Authorized Signatures Repairman and Station Certificate Numbers
	Reg # N58TR MFG McCauley Model 3AF32C511-B Serial #840961 SNEW/S MOH 1813 Hr Meter 1813	
	- Researched AD's thru 2008-14 (summary provided) AD83-13-06 DNA, AD03-13-17 DNA, AD05-14-11 DNA, AD06-24-07 DNA - Dressed blade leading edges - Adjusted TO RPM - Dynamically balanced engine / propeller assembly IAW ACES guide to dynamic balancing using 2020 probalancer, final solution = .06 IPS with 11 grams of weight added - Serviced unfeathering accumulator IAW Beech MM - Replaced de-ice brushes C40256-1 brushholder LH & C40256-2 brushholder RH	
	I certify this propeller was inspected in accordance with a 100 hour/Annual inspection and is determined to be in airworthy condition. Returned to service this date.	
	Signature:  Date: 8/1/2008 David Wayne Beaver AP 3097750 IA 8320 Thora Lane, #F-1, Spring, TX 77379, 281-376-6664	

NOTE: s On Pages 11 & 12

6

NOTE: Enter Compliance With All Applicable FAA A.D. & Factory Service Bulletins On Pages 11 & 12

8

Gregory Langham
A&P458476877

ice Bulletins On Pages 11 & 12

ures
tion
ers

NOTE: Enter Compliance With All Applicable FAA A.D. & Factory Service Bulletins On Pages 11 & 12

10

3592918
476877
Suzanne B. [Signature]

ins On Pages 11 & 12

Hagerstown Aircraft Services, Inc.

Certified Repair Station: CRS H5GRO500
Springs Road, Hagerstown, MD 21742 (301) 733-7604

14235 Oak Springs Road, Hagerstown, MD 21742 (301) 733-7604
 Certified Repair Station: CRS H3GR0500

02/28/14 HOBBS 384.3 PROP SMOH 868.1 PROP TT 2950.3 W/O
MAKE McCauley MODEL 3AF32C511-B S/N 840961

DATE 02
N# 58TR

HOBBS 384.3 PROP SMOH 868.1 PROP TT 2950.3 W/O 14010
MAKE McCauley MODEL 3AF32C511-B S/N 840961 (8H)

Dressed minor nicks on blades. Ground tan. Leak and ops checked OK. I certify this prop has been inspected I/A/W an annual inspection and was determined to be in airworthy condition. All work was performed I/A/W manufacturer's maintenance manuals and current federal aviation regulations.

Signed: Joseph S. Harte
Hagerstown Aircraft Services, Inc Hagerstown, MD 21742
FAA Approved Repair Station H5GR0500

Prope
ime

Freedom Aviation
310 Hangar Road
Lynchburg, VA 24502
(434) 237-3342
CRS# BGSR439C

Date: 3/20/2015; Aircraft: N58TR; Type: 58P; S/N: TJ-472; TT: 3,035.3; Hobbs: 469.2; WO#: 9496
Prop Model: 3AF32C511-B; S/N: 840961; Prop TT: 3040.3

Right Prop Entries

Complied with annual inspection on right prop IAW Beechcraft 58P AMM 5-20-00. Removed prop and sent to H&H Propeller Service CRS#: PS4R451M for reshim and pack under work order 20719. Reinstalled prop IAW Beechcraft 58P AMM 61-10...

Maintenance Release

The aircraft and/or component(s) as listed above were inspected in accordance with current Federal Aviation Regulations. Pertinent details are on file at this repair station.

Joe Leonard CRS#: BGR439C



F

1

[illegible]

Regulations. Pertinent details are on file at this repair station.


JOE LEONARD CRS# BGSR439C

10/1/18 N58TR S/N: TS-472 ACTT. 3264.1 TSO: 1181.8
Annual Inspection: I certify this prop HAS been
inspected AND WAS determined to be in an Airworthy condition.
AD conformity checked thru 2018-18. 7. Scott Hudak
AIP 3184964 IA. 10/1/18 ¹³