
ENGINE MAINTENANCE RECORDS



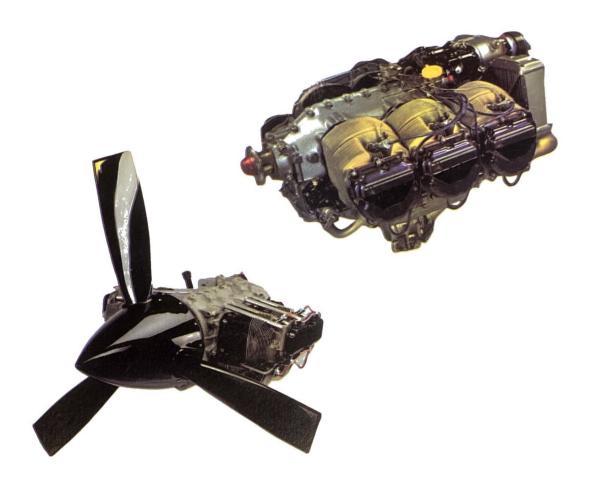

Shipping Address: 2505 W. Broadway, Collinsville, OK 74021 = Mailing Address: P.O. Box 582453, Tulsa, OK 74158-2453

Toll Free 888 371-1371 = 918 371-3000 = FAX 918 371-3041 = Look us up at www.overhaul.com = E-Mail: info@gverhaul.com

FAA Certified Repair Station IAXR223L



ENGINE MAINTENANCE RECORDS

Log No. _____

(All applicable information must be filled in)



| DATE | TOTAL TIME IN SERVICE | TOTAL TIME SINCE OVERHAUL | TACH OR RECORDING METER TIME | DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK | | | | | | | | |
|------|---|------------------------------------|--|---|----------------|---------------------|--------------------|--|--|--|--|--|
| | | | | TOTALS brought forward from previous page | | | | | | | | |
| | MAKE | CONTINE | | MODEL | 10-470-5 | | | | | | | |
| | SERIAL# 102513-2-5-1 TIME SMOH 0.0 | | | TOTAL TIME | 1/21/05 | | | | | | | |
| | | | | | han boon disas | sembled, overhauled | and tested in | | | | | |
| | America's Aircraft Engines, Inc. certifies that this engine has been disassembled, overhauled and tested in accordance with recommended procedures and all clearances and tolerances are within specified limits. X30586A | | | | | | | | | | | |
| | Procedures and limits used are as contained in engine mandicates. | | | | | | | | | | | |
| | America's Aircraft Engines, Inc. certifies the engine identified above was overhauled and inspected in | | | | | | | | | | | |
| | America's Aircraft Engines, Inc. certifies the engine identified above with current regulations of the Federal Aviation Administration and is approved for return to | | | | | | | | | | | |
| | service. Following A.D.'s complied with SEE NOTES. | | | | | | | | | | | |
| | | | | | | | | | | | | |
| | Pertinent details of the overhaul are on file at America's Aircraft Engines, Inc. work order number: | | | | | | | | | | | |
| | | | | 1 1 | | | | | | | | |
| | | lla | 1 | 1. Un | _ | For America's Airo | raft Engines, Inc. | | | | | |
| | Signed | SUL | hers. | For America's Aircraft Engines, Inc. PO Box 582453 | | | | | | | | |
| | | Authorize | ed Signature | | | Tulsa, OK 741 | | | | | | |
| | Tuisa, ON 1-11-5 | | | | | | | | | | | |
| | FORM A | AE 101 | CERTIFIE | ED REPAIR STAT | TION NO. IAXE | 223L | | | | | | |
| | CONTINENTAL IO-470-S S/N 102513-2-5-1 W/O 1104201 A.D. NOTES 1-20-2005 A.D. 70-14-07 R2 AMEND 39-2014 N/A PREVIOUSLY COMPLIED WITH. A.D. 72-20-02 R3 AMEND 39-1974 N/A INSTALLED FATORY NEW E.C.I. CYLINDERS. A.D. 79-05-09 AMEND 39-3426 N/A AFFECTED OIL PUMP NOT INSTALLED. A.D. 88-03-06 AMEND 39-5888 N/A AFFECTED OIL FILTER NOT INSTALLED. A.D. 91-19-03 AMEND 39-8865 C/W CORRECT OIL PICKUP TUBE INSTALLED. A.D. 93-08-17 AMEND 39-8665 C/W CORRECT OIL PICKUP TUBE INSTALLED. A.D. 93-10-02 AMEND 39-8603C/W NEW E.C.I. CYLLINDERS ARE ASSMEBLED CORRECTLY. A.D. 95-21-15 AMEND 39-9402 N/A OWNER OPERATOR RESPONSIBILITY TO USE PROPER GRADE FUEL A.D. 98-17-11 AMEND 39-10713 N/A AFFECTED CRANKSHAFT NOT INSTALLED. A.D. 2000-23-21 AMEND 39-11994 N/A AFFECTED CRANKSHAFT NOT INSTALLED. Stephen D. Fowler P# 447629769 | | | | | | | | | | | |
| | | | | SUB-TOTALS | this page | | | | | | | |
| | | | | | | | | | | | | |
| | | | The second secon | | y forward to | | | | | | | |



| | | | | rage No. |
|----------|--------------------------------|------------------------------------|---------------------------------------|---|
| DATE | TOTAL TIME IN SERVICE | TOTAL TIME SINCE OVERHAUL | TACH OR RECORDING METER TIME | DESCRIPTION OF WORK PERFORMED- SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK |
| | | | | TOTALS brought forward from previous page |
| Februale | 5 | 3383 | | installed engine replaced fuel toil |
| | | | | hoses, engine mounts airfilter |
| | | | | repaired bastles, exhaut brackets |
| | | | | engine run up + beall all oll |
| | | | | |
| | | | | nem inspected in accordance with |
| | | | | determined to be in size or thy |
| | | | | - File A101378 2807TH |
| 4-4- | 07 | TACH | 502.6 | Compression #1-12/80 2-72 3-74 |
| | | | 1 4 | 4-72 5-74 6-78 Changed oil, |
| | | | - | Added 100ks Phillips XC 20 W 50 Chaupa |
| | | | - | 18108 oil filter (40 metal) Rotated |
| | · · · · · · | | - | Spank Pluge Deposition 24112 AT |
| | | | | |
| | - | | | CERTIFY THAT THIS ENGINE & PROPERLER HAS BEEN INSPECTED IN ACCORDANCE WITH |
| | | | | A ANNUAL 100 HE INSPECTION AND |
| | | | | WAS FOUND TO BE IN AIRWORTHY CONDITION TOTAL TIME SMOH 11/16 DATE 4-4-07 |
| | | | | PAUL J. POPPENHAGER 2014641721A |
| | | | | (Seppenhar |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | SUB-TOTALS this page |
| ŀ | | | | TOTALS-Carry forward to next page |
| L | | | | TO IALS-Carry forward to float page |