



The Standard

AIRCRAFT LOG

ASA-SA-2

Aircraft Record General Information

Manufacturer CESSNA Model 172M
Serial 17266185 Registration Number N9505H
Date of Manufacture AW DATE 11/05/1975

Engine(s) currently installed:

Manufacturer LYCOMING Model O-320-E2D Serial RL-27780-27A
Manufacturer _____ Model _____ Serial _____

Propeller(s) currently installed:

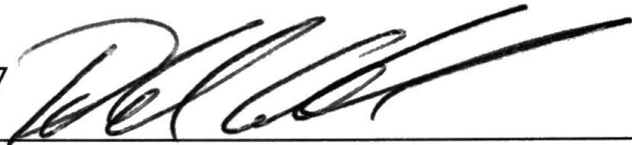
Manufacturer _____ Model _____

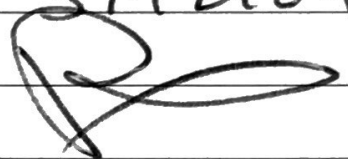
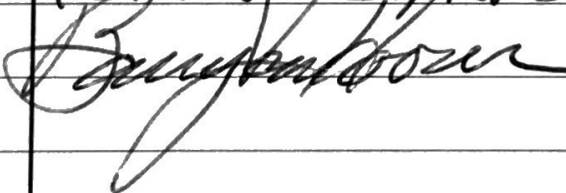
HUB Model _____ Serial _____ Serial _____

Blade Model _____ Serial _____ Serial _____ Serial _____

Blade Model _____ Serial _____ Serial _____ Serial _____

YEAR 20 ____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations <small>Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)</small>
				<p>SkyView Aviation →</p> <p style="text-align: right;">SkyView Aviation, LLC 5749 South Tracy Blvd Tracy CA, 95377 (510)785-7666</p> <hr/> <p>N Number: N9505H Tach: 4776.9 TTAF:</p> <p>Installed Overhauled MX300 NAV/COMM radio P/N AT1800 S/N 8742. Installed IAW CE172 service manual.</p> <p style="text-align: center;">-----END-----</p> <div style="margin-top: 100px;"> <p>Phillip Gibboney A&P 3192109 IA _____</p> <p>Date: 08/26/2009 X</p> </div>

YEAR 20____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations <small>Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)</small>
				<p>SkyView Aviation →</p> <p style="text-align: right;">SkyView Aviation, LLC 5749 South Tracy Blvd Tracy CA, 95377 (209) 830-7666</p> <hr/> <p>N Number: N9505H Tach: 4814 TTAF:</p> <p>Removed carburator, installed new Precision float kit P/N 666-915 as per manual. Test run engine all within normal peremeters.</p> <div style="margin-top: 100px;"> <p>Richard Ortenheim A&P 2517877</p> <p>Date: 01/28/2010 X </p> </div>

YEAR 2010 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
3-25	4828.8			DRAINER OIL Removed + Replaced FILTER WITH TEMPEST AA 48110-2 + SERVICED OIL WITH 89ts 15W50 SHELL W100 PLUS OIL FILTER NO DEFECTS LEAK CHECK GOOD AFR 3192109 
4-20-2010	4837.3			REMOVED AND REPLACED ALTERNATOR (PN: C611501-0102) IAW CESSNA 172 Skyhawk Series 1969-1976 Service Manual, Section 16-41, PG. 16-11. All work Performed, AND operational checkok-  AFR 53805738-END

YEAR 20 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
				Precision Static Testing Livermore, CA FAA Certified Repair Station #QJAR856X PHONE: (925) 449-5904 FAX (925) 449-6081 I certify that transponder tests, including data correspondence, required by § 91.413, have been performed & found to comply with 14 CFR Part 43, Appendices E & F. Time: <u>4843.6</u> W/O# <u>6272</u> N <u>9509H</u> Inspected by <u>[Signature]</u> Date <u>5/18/10</u>
5-29-2010	4843.6	Tach		ACTT 4843.6 ACSN 17266185 IAW The Cessna 172 AND Sky Hawk Series 1969-1976 Service Manual 100 Hour Check List Complied with 100 hour inspection IAW FAR 43 APP. D. Retorque landing gear bolts, overhauled Fuel Selector New O-Rings AND upper gasket Replaced AND tested For leaks AND operation Re-Torqued All Flight Control Mount Points, Replaced left AND right Aileron outboard Rod end bearings PN: 51106, lubed Flap Jack screw,

YEAR 20 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
5-29-2010	Continue			lubed All Flight Pulley AND Rotated, Repaired Instrument Panel Lights, cleaned AND Repacked MAIN wheel bearings, cleaned AND Repacked Nose Gear wheel Bearing, Reinstalled interior, C/W Reoccurring ADS (seat Rails), (Alternate Static Port), Removed AND Replaced New Center Console Plastics Modeling, Installed Fuel Placards on Wing. Verified interior Placards, lubricated Air vents levers. Replace Breather Hose with new MIL-6000 Hose. -END <i>Bang Van Horn</i> AP 523805738
5-29-2010	TTSN 4843.6 Tach 4843.6 1			Replaced ELT Batteries DUE AUG/12 Performed 91.207 (d) inspection, ELT operation Normal -END <i>Bang Van Horn</i> AP 523805738

YEAR 20 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
--------------------	---------------------------	-------------------	-----------------------------	---

05/29/10	N9505H	Tack	4843.6
Cessna 172	S/N 17266185	Actt.	4843.6
Lycoming O-320-E2D	S/N RL-27780-27A	Engnt.	534.6
		Engtso	534.6

Inspection completed:

Performed an Annual inspection of aircraft in conjunction with the 100 hour inspection and found aircraft airworthy after the listed discrepancies items are corrected as noted on the 100 hour/Annual inspection and discrepancies report.

Complied with applicable AD's on Airframe, engine, Appliances, and Propeller through FAA AD Bi-Weekly 2010-10. See AD listing for details.

I certify that the above listed inspection and repairs were completed in accordance with FAR 43Appendix D and Airframe Manufactures inspection and repair requirements and was determined to be in an airworthy condition for return to service.


Paul McSorrie ASEP 309054 IA

05/27/10

YEAR 20 <u>10</u> DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
8-8	4879.3			DRAINED OIL Removed & Replaced FILTER With Tempest AA 4810-2. Replaced 7 GTS AEROSHALL W 100 plus. No leaks and Runup TEST. - END - <i>Benny Van Horn</i> AP523805738
10/31/10	4973.3			DRAINED OIL Removed AND Replaced OIL STRAINER OIL FILTER Tempest AA 48110-2 Replaced with 7qt. phillip XC 20-50 TEST, RUN OK TEST Flight OK - END - <i>Benny Van Horn</i> AP523805738
2-26-11	4953.8			AEROSHALL 15W-50 DRAINED oil. Removed & Replaced FILTER With champion CH 481110-1. Replace 7 GTS. No leaks, Runup TEST - END - <i>Benny Van Horn</i> AP523805738
2-29-11	4955.2			New Radio # no value for VOR (Place card) <i>Benny Van Horn</i> PPL 3566953

YEAR
20
DATE

YEAR
20 11
DATE

RECORDING
TACH
TIME

TODAY'S
FLIGHT

TOTAL
TIME IN
SERVICE

Description of Inspections, Tests, Repairs and Alterations
Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)

3-20-11

4964

ch Both MAIN TIRES (AIR Hawk)

[Signature]

PPL 3566933


5-28-2011

4972.3

IAN the CESSNA 172 AND Sky Hawk Series 1969-1972
SERVICE MANUAL 100 HOUR check list complied with
100 HOUR INSPECTION. IAW FAR 43 APP D. Lubed Puff
wheel bearings; installed New Viera Mixture Control
Carb heat cable. Trim TAG, Control Surfaces Lubed
c/w Reassembly AD's (Seat Track, Muffler, Aft. Static Port)
-END- *[Signature]* ABZ 28078 -

YEAR 20 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
12/24/11	5001.2			REMOVED FLAP DRIVE MOTOR REPLACED BOTH MICROSWITCHES WITH NEW PARTS - REINSTALLED. OCS CHECK GOOD - Sgt ASR 2753062
12/11/12	5016.8			Installed new Raco Brake linings RAB6-109, checked good RT & LT brakes. Sgt ASR 3566933
3-9-12	5023.0			Installed wheel & landing light 12/14 volt. Sgt ASR 3566933

[illegible]

YEAR 20 ____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
5/18/12	5027.8			Precision Static Testing Livermore, CA FAA Certified Repair Station #QJAR856X PHONE: (925) 449-5904 FAX (925) 449-6081 I certify that transponder tests, including data correspondence, required by § 91.413, have been performed & found to comply with 14 CFR Part 43, Appendices E & F. Time: 5027.8 W/O# 8274 N9505H Inspected by  Date 5/19/12
Next due 5/14				
6-8-12	5028.3			RESOLDERED POSITIVE WIRE AT FLAP TRANSMITTER, OPERATIONAL CHECK GOOD - JJJ ASR 2703762
6/13/12	5031.8			Replaced SHARC-7 ELT Batteries. Next Tested OK. Next due 6-13-2014. JJJ ASR 2703762

[illegible]

YEAR
20 13
DATE

RECORDING
TACH
TIME

TODAY'S
FLIGHT

TOTAL
TIME IN
SERVICE

Description of Inspections, Tests, Repairs and Alterations
Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

3-18-13

5070.9

N9505H Cessna 172M S/N 17266185

March 18, 2013 Total Time 5070.9

Inspected aircraft per the scope and detail of FAR part 43 appendix D. I certify that this aircraft has been inspected in accordance with an annual inspection and was found to be in airworthy condition. Complied with AD 2011-10-09 by inspection of seat tracks, rollers and pins. Checked ELT per FAR 91.207d. Replaced vacuum regulator filter.



Samuel G. Tucker 2703762 IA

YEAR DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
2014 2-14	5102.1			<p>Precision Static Testing Livermore, CA FAA Certified Repair Station #QJAR856X PHONE: (925) 449-5904 FAX (925) 449-6081</p> <p>I certify that transponder tests, including data correspondence, required by § 91.413, have been performed & found to comply with 14 CFR Part 43, Appendices E & F.</p> <p>Time: <u>5:00 PM</u> W/O# <u>02304</u> N <u>9505H</u> Inspected by <u>5102.1</u> Date <u>3/12/14</u></p>
2014 2-21	5150			<p>Replacement of engine oil & oil filter. Disturbance of engine oil pan.</p>

YEAR 20 <u>14</u> DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterat Entries must be endorsed with Name, Rating and Certificate Number Technician or Repair Facility. (See back pages for other specific entr
------------------------------	---------------------------	-------------------	-----------------------------	---

04-2-14 5103.9

SkyView Aviation →

SkyView Aviation, LLC
5749 South Tracy Blvd
Tracy, CA 95377
(209)830-7666

N Number: N9505H Tach: 5103.9
TTAF 5103.9

Complied with **Annual inspection** in accordance with FAR 43 appendix D. Installed new instrument airfilters BA3-5 and RA1J10-1. Installed new ELT battery P/N BP-1015, inspected ELT battery in accordance with FAR 91.207(D) 1-4 and found airworthy, ELT due 06/16. Installed new airfilter BA6108. See AD list dated 04/02/2014 for AD information. All work done using applicable service manuals. Aircraft determined to be Airworthy.

Richard Ortenheim A&P 2517877 IA
Date: 04/02/2014 X



YEAR 2014	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
5/17	51203			Installed 2 Airhawk 6x600 MAINTIRES, cleaned packed main wheel bearings. <i>[Signature]</i> PR 3566933
-17-15	51388			Replaced Brake pads, RAPS RA066-30026-4K (RA 66-109-4K) <i>[Signature]</i> PPL 3566933
-21	5139.1			Replaced O-Ring Left Brake cylinder clear insp. Replaced Fluid. <i>[Signature]</i> PPL 3566933

YEAR 20 <u>15</u> DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------------------------------	---------------------------	-------------------	-----------------------------	---

SkyView Aviation →

SkyView Aviation, LLC
5749 South Tracy Blvd
Tracy, CA 95377
(209) 830-7666

N Number: N9505H Tach: 5144.4
TTAF 5144.4

Complied with **Annual inspection** in accordance with FAR 43 appendix D. Installed new instrument airfilters Tempest garter filter P/N 10-01333 and Rapco gyro air filter P/N DJ10-J. Inspected ELT battery in accordance with FAR 91.207(D) 1-4 and found airworthy, ELT battery replacement due 06/16. Installed new airfilter BA6108. Installed new brake linings Rapco RA066-30026. See AD list dated 03/08/2015 and old aircraft records for AD information. All work done using applicable service manuals. Aircraft determined to be Airworthy and returned to service.

Richard Ortenheim A&P 2517877 IA
Date: 03/08/2015 X



YEAR 20 <u>15</u> DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------------------------------	---------------------------	-------------------	-----------------------------	--

RECORDING TACH TIME

TODAY'S FLIGHT

**TOTAL
TIME IN
SERVICE**

Description of Inspections, Tests, Repairs and Alterations

Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

SkyView Aviation →

SkyView Aviation, LLC
5749 South Tracy Blvd
Tracy CA, 95377
(209) 830-7666

N Number: N9505H

Tach: 5144.9

TTAF:

Complied with SEL-25-03 paragraph 1. A and B no further action required part 505590-403 with date code A0709 installed. 、

Richard Ortenheim A&P 2517877
Date: 03/29/2015 **X**_____



4-

7-19-15 5151.1

FRONT STAGT Fluid Fill H5606, AIR 45 PSI. *Myling* PPL 352693

[illegible]

YEAR
2016
RECORDING
TACH
TIME

TODAY'S
FLIGHT
TOTAL
TIME IN
SERVICE

Description of Inspections, Tests, Repairs and Alterations
Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

SKYVIEW AVIATION

SkyView Aviation, LLC
5749 South Tracy Blvd
Tracy, CA 95377
(209)830-7666

N Number: N9505H Tach: 5178.2
TTAF 5178.2

Complied with **Annual inspection** in accordance with FAR 43 appendix D. Installed new instrument airfilters Tempest garter filter P/N 10-01333 and Rapco gyro air filter P/N DJ10-J. Inspected ELT battery in accordance with FAR 91.207(D) 1-4 and found airworthy, ELT battery replacement due 06/16. Installed new airfilter BA6108. Installed new Rod ends both Ailerons P/N S1106-3. Complied with AD2011-10-09 Seat slippage as per AD(g) 1 through 10 and found airworthy, next inspection due 100hrs or Annual. See AD list dated 03/08/2015 and old aircraft records for AD information. All work done using applicable service manuals. Aircraft determined to be Airworthy and approved for service.

Richard Ortenheim A&P 2517877 IA
Date: 03/21/2016 X



0-17-115187-

6

Install & check 7 ELT Batteries
Tested OK. Next due April 2016

[Signature]
PPL3566933

YEAR 2017 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
----------------------	---------------------------	-------------------	-----------------------------	---

SkyView Aviation

SkyView Aviation, LLC
5749 South Tracy Blvd
Tracy, CA 95377
(209) 830-7666

N Number: N9505H Tach: 5200.8
TTAF 5200.8

Complied with **Annual inspection** in accordance with FAR 43 appendix D.
Installed new instrument airfilter Tempest garter filter P/N 10-01333.
Inspected ELT battery in accordance with FAR 91.207(D) 1-4 and found
airworthy and returned to service, ELT battery replacement due 04/18.
Installed new airfilter BA6108. Complied with AD2011-10-09 Seat slippage
as per AD(g) 1 through 10 and found airworthy, next inspection due 100hrs
or Annual. See AD list dated 03/08/2015 and old aircraft records for AD
information. All work done using applicable service manuals. I certify that
this aircraft has been inspected in accordance with an Annual inspection
and was determined to be in airworthy condition.

Richard Ottenheim A&P 2517877 IA
Date: 03/16/2017 X



17-18

RECORDING
TACH
TIME

TODAY'S
FLIGHT

TOTAL
TIME IN
SERVICE

Description of Inspections, Tests, Repairs and Alterations
Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

72017 *WLA*

DATE: 11/4/2107 TACH: 5254.4 N9505H S/N 17266185

Remove lower half strut. Clean and inspect. Stoned several small deviants on chrome surface. Install seals static and piston seals with both backups and lower wiper seal in packing support ring from JMCNS1 strut seal kit. Applied hydraulic fluid to seals and wiper for installation. Installed lower strut half and installed lock ring with one end near extraction hole. Filled strut with hydraulic fluid, installed Schrader valve. inflated strut to the height as outlined in manual. This aircraft is approved for return to service.

Steven Bradford A&P 1919597

Steven Bradford

-3-18 5250.3

Installed new brake pads. inspect wheels,
OK. Rapco RA06-30026AK (RA06-109)

PL 3526953

YEA
20
DAT

YEAR
20 18
DATE

RECORDING
TACH
TIME

TODAY'S
FLIGHT

TOTAL
TIME IN
SERVICE

Description of Inspections, Tests, Repairs and Alterations
Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

3/23/18 5256.4

Precision Static Testing Livermore, CA
FAA Certified Repair Station #QJAR856X
PHONE: (925) 449-5904 FAX (925) 449-6081

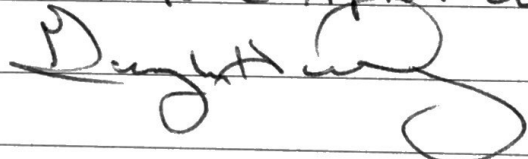
I certify that transponder tests, including data correspondence, required by § 91.413, have been performed and found to comply with 14 CFR Part 43, appendix E and F.

Time: 5256.4 W/O# 14292 N 9505H

Inspected by  Date 3/23/18

4-5-18 5257.1

INSTALL SHARC-7 ELT BATTERIES. TEST OK.
PX # DP 1015 NEXT DUE APR. 20/20.

 PPL 35W433

RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
---------------------------	-------------------	-----------------------------	---

SkyView Aviation

SkyView Aviation, LLC
5749 South Tracy Blvd
Tracy, CA 95377
(209)830-7666

N Number: N9505H Tach: 5254.6
TTAF 5254.6

Complied with **Annual inspection** in accordance with CFR 43 appendix D. Installed new instrument airfilter Tempest garter filter P/N 10-01333. Inspected ELT battery in accordance with FAR 91.207(D) 1-4 and found airworthy and returned to service, ELT battery replacement due 04/2020. Installed new airfilter BA6108. Complied with AD2011-10-09 Seat slippage as per AD(g) 1 through 10 and found airworthy, next inspection due 100hrs or Annual. See AD list dated 04/12/2018 and old aircraft records for AD information. All work done using applicable service manuals. I certify that this aircraft has been inspected in accordance with an Annual inspection and was determined to be in airworthy condition.

Richard Ortenheim A&P 2517877 IA
Date: 04/12/2018 X 

YE 20 DA

YEAR
2019
DATE

RECORDING
TACH
TIME

TODAY'S
FLIGHT

TOTAL
TIME IN
SERVICE

Description of Inspections, Tests, Repairs and Alterations
Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)

2-23-19

5276.0

5

R&R FRONT TIRE NEW AIR HAUL 500x50
New Tube 1 each and 500x50, Repair
insp wheel bearings.

John G PPL-3514

RECORDING
TACH
TIME

TODAY'S
FLIGHT

TOTAL
TIME IN
SERVICE

Description of Inspections, Tests, Repairs and Alterations
Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

SkyView Aviation →

SkyView Aviation, LLC
5749 South Tracy Blvd
Tracy, CA 95377
(209)830-7666

N Number: N9505H

Tach:

5276.3

TTAF

5276.3

Complied with **Annual inspection** in accordance with CFR 43 appendix D. Installed new instrument airfilter Tempest garter filter P/N 10-01333. Inspected ELT battery in accordance with FAR 91.207(D) 1-4 and found airworthy and returned to service, ELT battery replacement due 04/2020. Installed new airfilter BA6108. Complied with AD2011-10-09 Seat slippage as per AD(g) 1 through 10 and found airworthy, next inspection due 100hrs or Annual. See AD list dated 04/12/2018 and old aircraft records for AD information. All work done using applicable service manuals. I certify that this aircraft has been inspected in accordance with an Annual inspection and was determined to be in airworthy condition.

Richard Ortenheim A&P 2517877 IA
Date: 04/02/2019 X



Description of Inspections, Tests, Repairs and Alterations
 Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)

Precision Static Testing Livermore, CA
FAA Certified Repair Station #QJAR856X
PHONE: (925) 449-5904 FAX (925) 449-6081

I certify that transponder tests, including data correspondence, required by § 91.413, have been performed and found to comply with 14 CFR Part 43, Appendix E and F.

Time: 5319.0 W/O# 17370 N 95054

Inspected by [Signature] Date 31/8/2025

3/15/2020	5319.0
-----------	--------

~~10/29/21~~

~~Installed new concord RG 25 Aircraft~~
~~Battery sub # 41182923. Day found ppls sub~~
See entry following page.

AR TE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
----------	---------------------------	-------------------	-----------------------------	---

SkyView Aviation →

SkyView Aviation, LLC
5749 South Tracy Blvd
Tracy, CA 95377
(209)830-7666

N Number: N9505H Tach: 5319.7
TTAF 5319.7

Complied with **Annual inspection** in accordance with CFR 43 appendix D. Installed new instrument airfilter PNU P/N 1J10-1 and Garter filter RAD3-5-1. Installed new ELT battery P/N BP1015, inspected ELT battery in accordance with FAR 91.207(D) 1-4 and found airworthy and returned to service, ELT battery replacement due 04/2022. Corrosion protected entire aircraft with ACF-50 corrosion treatment. Installed new airfilter BA6108. Complied with AD2011-10-09 Seat slippage as per AD(g) 1 through 10 and found airworthy, next inspection due tach 5419.7 or Annual. See AD list dated 04/15/2020 and old aircraft records for AD information. I certify that this aircraft has been inspected in accordance with an Annual inspection and was determined to be in airworthy condition.

Richard Ortenheim A&P 2517877 IA
Date: 04/15/2020 X



YEAR
2021
DATE

RECORDING
TACH
TIME

TODAY'S
FLIGHT

TOTAL
TIME IN
SERVICE

Description of Inspections, Tests, Repairs and Alterations
Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

SkyView Aviation →

SkyView Aviation, LLC
5749 South Tracy Blvd
Tracy, CA 95377
(209)830-7666


N Number: N9505H Tach: 5363.5
TTAF 5363.5

Complied with **Annual inspection** in accordance with CFR 43 appendix D. Installed new instrument airfilter PNU P/N 1J10-1 and Garter filter RAD3-5-1. Inspected ELT battery in accordance with FAR 91.207 C & D and found airworthy and returned to service, ELT battery replacement due 04/2022. Installed new airfilter BA6108. Installed new Rapco brake disc's P/n RA164-30195 and rapco linings 4x RA66-109. Installed Alcor EGT type K P/N 46150 gauge as per STCSA522SW, see 337 form dated 06/02/2021 for further information. Complied with AD2011-10-09 Seat slippage as per AD(g) 1 through 10 and found airworthy, next inspection due tach 5463.5 or Annual. See AD list dated 04/15/2020 and old aircraft records for AD information. I certify that this aircraft has been inspected in accordance with an Annual inspection and was determined to be in airworthy condition.

Richard Ortenheim A&P 2517877 IA
Date: 06/02/2021 X



YEAR DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations <small>Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)</small>
1-7-21	5375-1			installed concord sealed BATTERY
1-7-21	5375-1			INSTALLED CONCORDE SEALED BATTERY RCI-25, SN# 41182923. <i>[Signature]</i> PPL3566933
				Precision Static Testing Livermore, CA Phone 925-449-5904 FAA Certified Repair Station #QJAR856X
				I certify that transponder tests, including data correspondence, required by § 91.413, have been performed and found to comply with 14 CFR Part 43, Appendix E and F.
				Time: <u>53921</u> W/O# <u>20875</u> N <u>9505H</u>
				Inspected by <u><i>[Signature]</i></u> Date <u>3/19/2022</u>
4-21-22	5394-1			INSTALLED NEW ELT BATTERY BP-1015, inspected BATTERY PER FAR 91.207(D) AIRWORTHY OK. NEXT DUE 4-20-24. <i>[Signature]</i> PPL3566933

YEAR 20____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations <small>Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)</small>
				<div style="text-align: right;"> SkyView Aviation, LLC 5749 South Tracy Blvd Tracy, CA 95377 (209)830-7666 </div> <div style="text-align: center;"> <u>SkyView Aviation</u> → </div> <hr/> <div> N Number: N9505H Tach: 5395.9 TTAF 5395.9 </div> <p> Complied with Annual inspection in accordance with CFR 43 appendix D. Installed new instrument airfilter PNU P/N 1J10-1 and Garter filter RAD3-5-1. Inspected ELT battery in accordance with FAR 91.207 C & D and found airworthy and returned to service, ELT battery replacement due 04/2024. Installed new airfilter BA6108. Complied with AD2011-10-09 Seat slippage as per AD(g) 1 through 10 and found airworthy, next inspection due tach 5495.9 or Annual. See AD list dated 06/20/2022 and old aircraft records for AD information. I certify that this aircraft has been inspected in accordance with an Annual inspection and was determined to be in airworthy condition. </p> <div style="display: flex; justify-content: space-between; align-items: flex-end; margin-top: 20px;"> <div> Richard Ortenheim A&P 2517877 IA Date: 07/01/2022 X </div> <div>  </div> </div>