



RAM AIRCRAFT
The Engine Specialist
FOR CESSNA, BECHTEL, and other aircraft



PROPELLER MAINTENANCE RECORDS

Aircraft Registration N1557T
Propeller Position Left
Propeller Serial No. EB8401B

7505 Karl May Dr. | P.O. Box 5219 | Waco Regional Airport | Waco, TX 76708 | Phone: (254) 752-8381 | Fax: (254) 752-3307 | www.ramaircraft.com



PROPELLER MAINTENANCE RECORDS

Log No. 1

Aircraft Registration No. N1557T

Propeller Manufacturer Hartzell

Hub Model PHC-C3V/F-2UF

Blade Design No. FC7693DFB

Hub Serial No. EB8401B

Blade Serial No's.

1. 199788
2. 199789
3. 199793
4. _____

Pitch Range:

High 18.0 Low 13.0

Feather 8.1 Reverse N/A

Governor Manufacturer McCauley

Model No. D20741-1

Serial No. 180019

Date installed on aircraft 12.18.19

Time Between Overhauls (TBO) 2400 Hours

If used on multi-engine aircraft:

- | | |
|---|--------------------------------|
| <input checked="" type="checkbox"/> Left | <input type="checkbox"/> Right |
| <input checked="" type="checkbox"/> Front | <input type="checkbox"/> Rear |

(All applicable information must be filled in)

Waco Regional Airport
7505 Karl May Drive • P.O. Box 5219 • Waco, Texas 76708
Phone: (254) 752-8381 Fax: 254-752-3307
www.ramaircraft.com

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATION NO. OF PERSON PERFORMING WORK
				TOTALS brought forward from previous page

Date	Airframe Total Time	Total Time Since Overhaul	Recording Meter Time
12/18/19	7022.3	0.0	397.4

RAM
RAM Aircraft, Limited Partnership • Waco Regional Airport

Hartzell Propeller PHC-C3YF-2UF/FC7693DFB

This propeller S/N EB8401B installed in the left position on Cessna S/N 414-0272 with 0.0 hours since factory new. Installed new prop governor S/N 180019. Pertinent details on file under Project No. 9243.

RAM Aircraft, Limited Partnership, P.O. Box 5219, Waco, Texas 76708 CRS VA1R551K

Date	Total Time In Service	Total Time Since Overhaul	Recording Meter Time
12/27/19	2.0		399.4

RAM
RAM Aircraft, Limited Partnership • Waco Regional Airport

Hartzell Propeller PHC-C3YF-2UF/FC4693DFB

This propeller S/N EB8401B lubricated in accordance with HARTZELL Manual No. 115N, Section 6, Chapter 2. Paragraph A. (3). Pertinent details on file under Project No. 9243.

RAM Aircraft, Limited Partnership, P.O. Box 5219, Waco, Texas 76708 CRS VA1R551K

SO#	20-0056	Elevate Air Services.				DATE	6/NOV/2020
REG.	N1557T	Crete Municipal Airport [CEK]				TACH	
MAKE	Hartzell	MODEL	PHC-J3YF-2UF	SERIAL NO.	EB8401B	HOUR	556.4
	Propeller	PTT	556.4	PTSOH	0.0		

Maintenance Record Left Propeller

1. Complied with Annual Inspection/100 Hour referencing the Beech Baron 58P Chapter 5-20 and the scope and detail of Title 14 CFR Part 43 Appendix (d). Performed engine/propeller ground run/leak check with no discrepancies noted at this time.
2. Test ran engine and checked for leaks and vibration, found to be within normal limits.

I certify this (aircraft) (engine) (propeller) has been inspected in accordance with an Annual/100 Hour inspection as per Title 14 CFR part 91.409 (a)(1) and was determined to be in an airworthy condition
Dated November 6, 2020 Shop Order: 20-0056

Signed

Shaun Krzycki
A&P 3624942

Signed

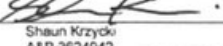
James Dux
A&P 28158851A

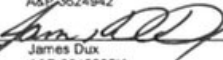
SO#	21-0077	Elevate Air Services.				DATE	22/NOV/2021
REG.	N1557T	Crete Municipal Airport [CEK]				TACH	
MAKE	Hartzell	MODEL	PHC-J3YF-2UF	SERIAL NO.	EB8401B	HOUR	718.5
	Propeller	PTT	718.5	PTSOH	718.5		

Maintenance Record Left Propeller

1. Complied with Annual Inspection/100 Hour referencing the Cessna 414 Service Manual Section 2A and the scope and detail of Title 14 CFR Part 43 Appendix (d). Performed engine/propeller ground run/leak check with no discrepancies noted at this time.
2. Dressed propeller to remove knicks.
3. Test ran engine and checked for leaks and vibration, found to be within normal limits.

I certify this (aircraft) (engine) (propeller) has been inspected in accordance with an Annual/100 Hour inspection as per Title 14 CFR part 91.409 (a)(1) and was determined to be in an airworthy condition.
Dated: November 22, 2021 Shop Order: 21-0077

Signed: 
Shaun Krzycki
A&P 3624942

Signed: 
James Dux
A&P 2815885/A

SO#	22-0080	Elevate Air Services.				DATE	13/JAN/2023
REG.	N1557T	Crete Municipal Airport [CEK]				TACH	
MAKE	Hartzell	MODEL	PHC-J3YF-2UF	SERIAL NO.	EB8401B	HOUR	807.5
	Propeller	PTT	807.5	PTSOH	807.5		

Maintenance Record Left Propeller

1. Complied with Annual Inspection/100 Hour referencing the Cessna 414 Service Manual Section 2A and the scope and detail of Title 14 CFR Part 43 Appendix (d). Performed engine/propeller ground run/leak check with no discrepancies noted at this time.
2. Test ran engine and checked for leaks and vibration, found to be within normal limits.

I certify this (aircraft) (engine) (propeller) has been inspected in accordance with an Annual/100 Hour inspection as per Title 14 CFR part 91.409 (a)(1) and was determined to be in an airworthy condition.
Dated: January 13, 2023 Shop Order: 22-0080

Signed: 
Shaun Krzycki
A&P 3624942

—
TIMING WORK

SUB-TOTALS this page

TOTALS—Carry forward to next page