

Aircraft N-Number Search Results

Miscellaneous Information

N-Number:	Serial Number:	Year Built:	Registered To:
8228J	34-8070252	1980	JEROME GEORGE A

Aircraft Information

Manufacturer:	Model:
PIPER	PA-34-200T

Engine Information

Manufacturer:	Model:
CONT MOTOR	TSIO-360 SER - LTS10-360KB TS10-360KB

A.D. COMPLIANCE 12-23-07

AIRFRAME

ENGINES

PROPS

ACCESSORIES - APPLIANCES

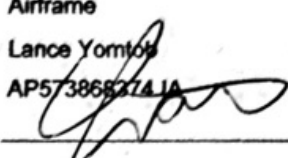
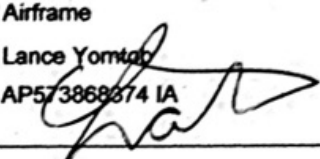
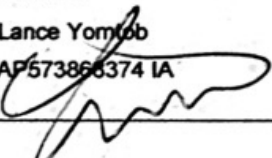
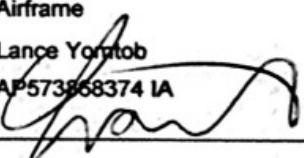
*UP-TO-DATE 9/2023 *

HOWA APS22868374IA

AD Compliance Report

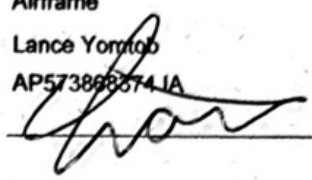
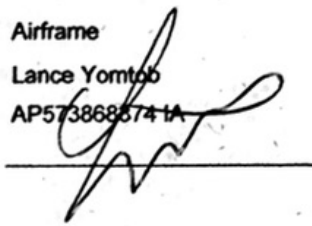
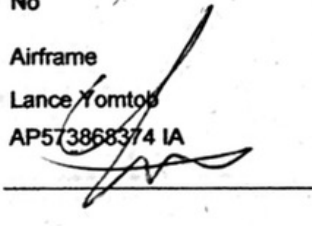
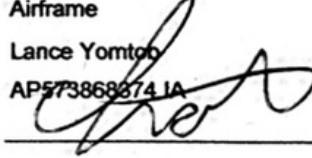
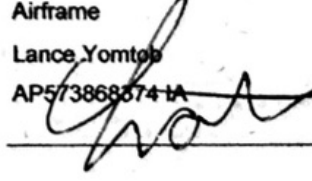
Airframe - Piper - PA-34-200T

S/N-34-8070252

DO #	Subject	Date and Hours at Compliance	Recurring Yes/No	Next Due Date/Hours
20-03	Usable fuel data		No	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtob	
Effective Date:	10/10/1975	Certificate #:	AP573868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BY S/N			
24-02	Loose seats		Yes	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtob	
Effective Date:	11/21/1975	Certificate #:	AP573868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BY S/N			
25-03	Engine oil		No	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtob	
Effective Date:	12/10/1975	Certificate #:	AP573868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BY S/N			
23-03	Rod end bearings		No	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtob	
Effective Date:	11/14/1977	Certificate #:	AP573868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BY S/N			

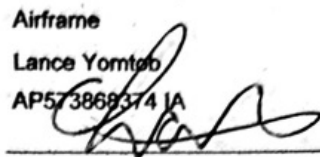
Airframe - Piper - PA-34-200T

S/N-34-8070252

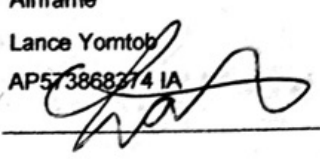
AD #	Subject	Date and Hours at Compliance	Recurring Yes/No	Next Due Date/Hours
78-21-03	Fuel lines		No	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtoob	
Effective Date:	10/26/1978	Certificate #:	AP573868374 IA	
Supersedes:	78-11-04	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BY S/N			
80-09-04	Vertical fin and stabilator		No	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtoob	
Effective Date:	04/24/1980	Certificate #:	AP573868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BY S/N			
80-14-03	Bendix, King or Narco transmit		No	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtoob	
Effective Date:	07/01/1980	Certificate #:	AP573868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BY S/N			
86-17-01	Ammeter replacement	12-9-86 1393.64 hrs	No	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtoob	
Effective Date:	08/21/1986	Certificate #:	AP573868374 IA	
Supersedes:	80-24-03	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	P/C/W			
Notes:	KIT # 765-186 INSTALLED			
88-04-05	Baggage compartment door	5-6-80	No	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtoob	
Effective Date:	02/16/1988	Certificate #:	AP573868374 IA	
Supersedes:	79-23-01, 81-10-03	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	P/C/W			
Notes:	IAW SB 633B AD # 81-10-03			

Airframe - Piper - PA-34-200T

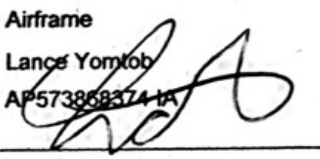
S/N-34-8070252

AD #	Subject	Date and Hours at Compliance	Recurring Yes/No	Next Due Date/Hours
92-08-04	Loss of rudder control	4-8-93 1880 HRS LT	Yes	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtov	
Effective Date:	05/15/1992	Certificate #:	AP573868374 IA	
Supersedes:	90-17-04	Authorized Sign.:		
Superseded By:	N/A			

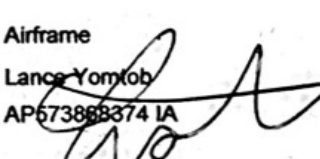
Compliance: P/C/W
 Notes: BY INSP see LOG BOOK ENTRY (HAS STEEL FITTING)

92-13-05	Inability to extend nose gear		No	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtov	
Effective Date:	08/21/1992	Certificate #:	AP573868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			

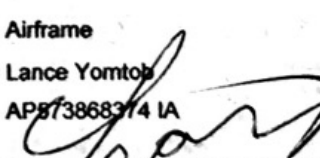
Compliance: P/C/W
 Notes: new HARDWARE installed

93-24-14	Nose landing gear		Yes	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtov	
Effective Date:	01/28/1994	Certificate #:	AP573868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	2005-13-16			

Compliance:
 Notes: see AD # 2005-13-16

94-13-11	Main landing gear	2068 HRS 9-21-96	Yes	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtov	
Effective Date:	08/12/1994	Certificate #:	AP573868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			

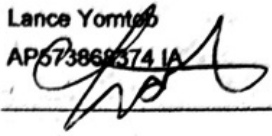
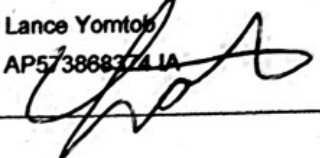
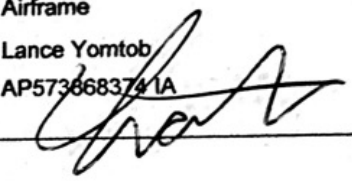
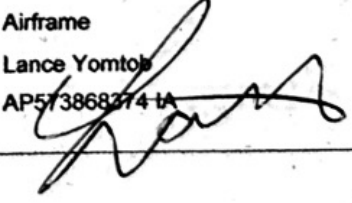
Compliance: P/C/W new STYLE TRUNNIONS installed
 Notes: REPETITIVE INSP no longer Applies

95-20-07	Landing gear inspection		Yes	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtov	
Effective Date:	11/17/1995	Certificate #:	AP573868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	97-01-01			

Compliance:
 Notes: see AD # 97-01-01

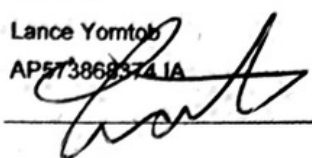
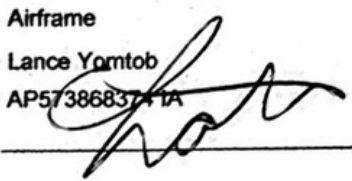
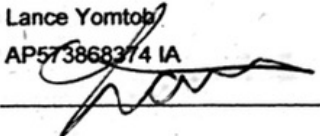
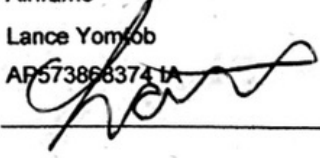
Airframe - Piper - PA-34-200T

S/N-34-8070252

D #	Subject	Date and Hours at Compliance	Recurring Yes/No	Next Due Date/Hours
1-10-03	Flap handle	9-21-96 2068 HRS	No	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtob	
Effective Date:	06/14/1996	Certificate #:	AP573868374 1A	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	P/C/W			
Notes:	new HARDWARE INSTALLED			
7-01-01	CORRECTION - Landing gear inspection		Yes	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtob	
Effective Date:	02/07/1997	Certificate #:	AP573868374 1A	
Supersedes:	95-20-07	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BY S/W			
7-01-01 R1	Main landing gear (MLG) collapse		Yes	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtob	
Effective Date:	12/08/1998	Certificate #:	AP573868374 1A	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BY S/W			
8-04-27	Severe Icing Conditions		No	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtob	
Effective Date:	03/03/1998	Certificate #:	AP573868374 1A	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	99-14-01			
Compliance:				
Notes:	see AD# 99-14-01			
99-05-09	Damaged induction air filter		No	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtob	
Effective Date:	03/19/1999	Certificate #:	AP573868374 1A	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BY S/W			

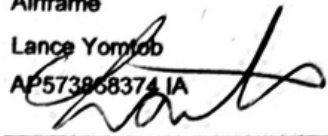
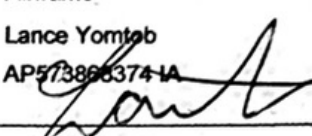
Airframe - Piper - PA-34-200T

S/N-34-8070252

AD #	Subject	Date and Hours at Compliance	Recurring Yes/No	Next Due Date/Hours
19-14-01	Minimize the potential hazards	1-18-02 2352.9	No	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtob	
Effective Date:	08/17/1999	Certificate #:	AP573868374 IA	
Supersedes:	98-04-27	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	Pk/w			
Notes:	UPDATED P.O.H			
2003-11-14	CORRECTION - Correct quality control problems with the heater fuel pump		No	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtob	
Effective Date:	6/20/2003	Certificate #:	AP573868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	2005-15-10			
Compliance:				
Notes:	See AD # 2005-15-10			
2005-13-16	Detect, correct, and prevent failure in certain components of the NLG	7-1-09 RT=2471 HRS	Yes	RT = 2971 HRS
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtob	
Effective Date:	08/08/2005	Certificate #:	AP573868374 IA	
Supersedes:	93-24-14	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	Pk/w			
Notes:	HARDWARE REPLACED (INSP IAW 1123A 8-2017)			FOUND TO BE OK AT THIS TIME
2005-15-10	To correct quality control problems with the heater fuel pump	7-1-05	No	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtob	
Effective Date:	08/26/2005	Certificate #:	AP573868374 IA	
Supersedes:	2003-11-14	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	Pk/w			
Notes:	BY INSP IAW SB 1127B PIPER			

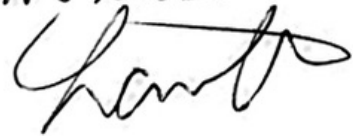
Airframe - Piper - PA-34-200T

S/N-34-8070252

AD #	Subject	Date and Hours at Compliance	Recurring Yes/No	Next Due Date/Hours
2010-15-10	To detect and correct any incorrectly assembled control wheel shafts	2010-15 10-15-2010 LT = 2457 HRS	No	
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtob	
Effective Date:	08/31/2010	Certificate #:	AP573868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	P/K/W BY INSP			
Notes:	FOUND TO BE OK			
013-02-13	To prevent failure of the horizontal stabilator control system and could result in loss of pitch control	3-20-2021 RT=2597.6	Yes	3-20-2028 OR 4597.6 HRS
Description:	Airframe - Piper - PA-34-200T	Category:	Airframe	
Component:	Airframe - Piper - PA-34-200T	Mechanic name:	Lance Yomtob	
Effective Date:	03/11/2013	Certificate #:	AP573868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	P/K/W BY INSP			
Notes:	OK AT THIS TIME & DATE			

2022-03-15 GARMIN Fight System

N/A: due to no modification was done to this airplane pertaining to this AD

LANCE YOMTOB
AP572868374


C/W AD#2023-09-09 V band couplings IAW para (1)(ii) for both engines when the hours come due, see each engine AD list for the hours,

Lance Yomtob AP572868374 IA

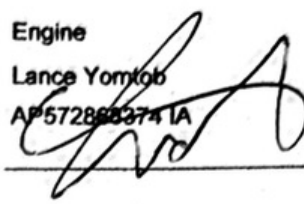
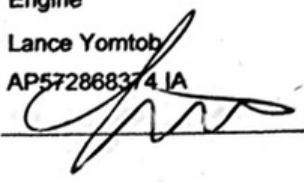
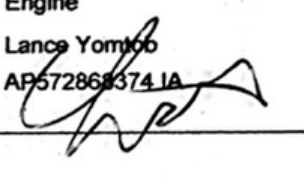
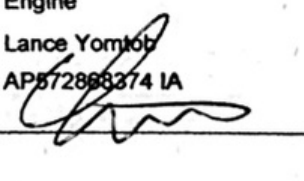


AD Compliance Report

Engine - Continental Motors - TSIO-360-KB

S/N-315348

Left Engine

AD #	Subject	Date and Hours at Compliance	Recurring Yes/No	Next Due Date/Hours
13-10 R1	Engine oil pump drive shaft		No	
Description:	Engine - Continental Motors - TSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Lance Yomtob	
Effective Date:	11/20/1981	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BY S/N			
23-02	Oil filter adapter gasket		No	
Description:	Engine - Continental Motors - TSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Lance Yomtob	
Effective Date:	10/30/1981	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BY S/N			
03-06	Oil filter		No	
Description:	Engine - Continental Motors - TSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Lance Yomtob	
Effective Date:	02/05/1988	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	FILTER NOT INSTALLED UPTODATE FILTER INSTALLED			
1-19-03	Champion oil filter		No	
Description:	Engine - Continental Motors - TSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Lance Yomtob	
Effective Date:	09/29/1991	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	FILTER NOT INSTALLED UPTODATE FILTER INSTALLED			

Engine - Continental Motors - TSIO-360-KB

S/N-315348


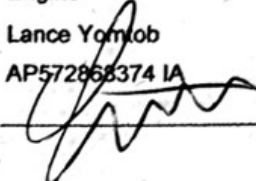
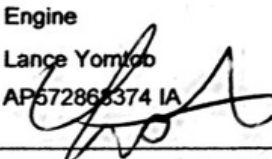
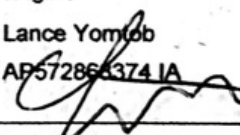
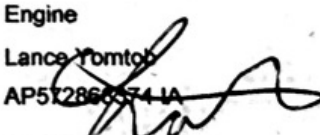
Left Engine

D #	Subject	Date and Hours at Compliance	Recurring Yes/No	Next Due Date/Hours
2-04-09	Rocker shaft	Category:	No	
Description:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Certificate #:	Lance Yomtov	
Effective Date:	02/18/1992	Authorized Sign.:	AP572868374 IA	
Supersedes:	92-02-20 R1			
Superseded By:	N/A			
Compliance:	N/A			
Notes:	B7 S/N			
3-10-02	Cylinder valve retainer	Category:	No	
Description:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Certificate #:	Lance Yomtov	
Effective Date:	05/17/1993	Authorized Sign.:	AP572868374 IA	
Supersedes:	N/A			
Superseded By:	N/A			
Compliance:	N/A			
Notes:	Eng O/H 6-1998			
4-14-12	Low octane detonation	Category:	No	
Description:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Certificate #:	Lance Yomtov	
Effective Date:	Upon receipt	Authorized Sign.:	AP572868374 IA	
Supersedes:	N/A			
Superseded By:	95-21-15			
Compliance:	N/A			
Notes:	BY "N" NUMBER			
5-08-10	Turbocharger check valves	Category:	No	
Description:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Certificate #:	Lance Yomtov	
Effective Date:	07/10/1995	Authorized Sign.:	AP572868374 IA	
Supersedes:	N/A			
Superseded By:	N/A			
Compliance:	N/A			
Notes:	O/H 6-1998			
5-21-15	Engine teardown and analytical inspect.	Category:	No	
Description:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Certificate #:	Lance Yomtov	
Effective Date:	11/28/1995	Authorized Sign.:	AP572868374 IA	
Supersedes:	94-14-12			
Superseded By:	N/A			
Compliance:	N/A			
Notes:	B7 "N" NUMBER			

Engine - Continental Motors - TSIO-360-KB

S/N-315348

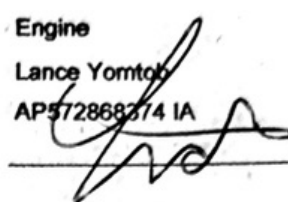
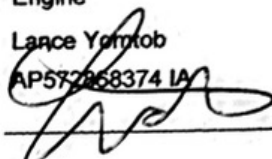
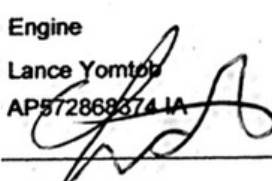
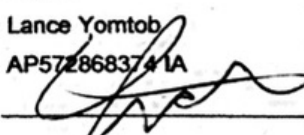

Left Engine

D #	Subject	Date and Hours at Compliance	Recurring Yes/No	Next Due Date/Hours
7-26-17	CORRECTION - Crankshaft fatigue cracks		Yes	
Description:	Engine - Continental Motors - TSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Lance Yomtob	
Effective Date:	01/23/1998	Certificate #:	AP572868374 IA	
Supersedes:	87-23-08	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	Eng O/H 6-3-98 VAR CRANK			
1-19-02	PMA piston pin		No	
Description:	Engine - Continental Motors - TSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Lance Yomtob	
Effective Date:	11/09/1998	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	NOT INSTALLED			
2000-08-51	Crankshaft connecting rod journal fracture		Yes	
Description:	Engine - Continental Motors - TSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Lance Yomtob	
Effective Date:	Upon Receipt	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	2000-23-21			
Compliance:				
Notes:	See AD# 2000-23-21			
2000-11-51	Possible engine failure		No	
Description:	Engine - Continental Motors - TSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Lance Yomtob	
Effective Date:	06/07/2000	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	2002-13-04			
Compliance:				
Notes:	See AD# 2002-13-04			
2000-23-21	Fracture of the crankshaft connecting rod journal		No	
Description:	Engine - Continental Motors - TSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Lance Yomtob	
Effective Date:	12/12/2000	Certificate #:	AP572868374 IA	
Supersedes:	PL2000-08-51	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BY O/H DATE NO.			

ine - Continental Motors - TSIO-360-KB

S/N-315348


Left Engine

#	Subject	Date and Hours at Compliance	Recurring Yes/No	Next Due Date/Hours
2-13-04	CORRECTION - Prevent engine failure and loss of control of the airplane		No	
Description:	Engine - Continental Motors - TSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Lance Yomtov	
Effective Date:	07/12/2002	Certificate #:	AP572868374 IA	
Supersedes:	PL2000-11-51	Authorized Sign.:		
Superseded By:	2011-26-07			
Compliance:	See AD # 2011-26-07			
Notes:				
9-24-51	To address rapid wear on the face of hydraulic lifters		Yes	
Description:	Engine - Continental Motors - TSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Lance Yomtov	
Effective Date:	Upon Receipt	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	2009-24-52			
Compliance:	See AD # 2009-24-52			
Notes:				
9-24-52	To address rapid wear on the face of hydraulic lifters		Yes	
Description:	Engine - Continental Motors - TSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Lance Yomtov	
Effective Date:	Upon Receipt	Certificate #:	AP572868374 IA	
Supersedes:	2009-24-51	Authorized Sign.:		
Superseded By:	2010-11-04			
Compliance:	See AD # 2010-11-04			
Notes:				
10-11-04	To prevent excessive hydraulic lifter wear		Yes	
Description:	Engine - Continental Motors - TSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Lance Yomtov	
Effective Date:	06/16/2010	Certificate #:	AP572868374 IA	
Supersedes:	2009-24-52	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	PART (LIFTERS NOT) INSTALLED			
11-26-07	To prevent engine failure due to migration of the magneto impulse coupling stop pin		Yes	
Description:	Engine - Continental Motors - TSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Lance Yomtov	
Effective Date:	1/24/2012	Certificate #:	AP572868374 IA	
Supersedes:	2002-13-04	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	NOT INSTALLED			

Engine - Continental Motors - TSIO-360-KB

S/N-315348

Left Engine

AD #	Subject	Date and Hours at Compliance	Recurring Yes/No	Next Due Date/Hours
2012-03-06	To prevent an in-flight shutdown due to a failed fuel servo diaphragm		Yes	
Description:	Engine - Continental Motors - TSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - TSIO-360-KB	Mechanic name:	Lance Yomtob	
Effective Date:	02/24/2012	Certificate #:	AP572868374 IA	
Supersedes:	2011-15-10	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BY PART INSTALLED			

AD#2023-05-16 crankshaft counterweight and hardware inspection is N/A IAW MSB 23-01A by date and hours,

Lance Yomtob AP572868374 IA



C/W AD#2023-09-09 V band coupling assembly when the left tachometer reads 502.6 hours IAW para (1)(ii)

Lance Yomtob AP572868374 IA



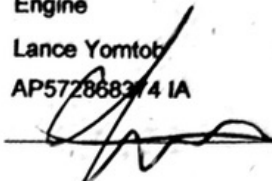
AD Compliance Report

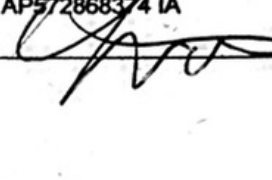
Page 1

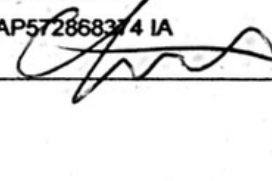
Engine - Continental Motors - LTSIO-360-KB

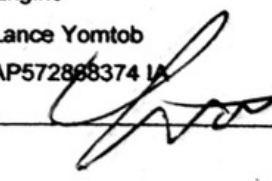
S/N-314346

Right Engine

AD #	Subject	Date and Hours at Compliance	Recurring Yes/No	Next Due Date/Hours
81-13-10 R1	Engine oil pump drive shaft		No	
Description:	Engine - Continental Motors - LTSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - LTSIO-360-KB	Mechanic name:	Lance Yomtob	
Effective Date:	11/20/1981	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BT S/N			

81-23-02	Oil filter adapter gasket		No	
Description:	Engine - Continental Motors - LTSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - LTSIO-360-KB	Mechanic name:	Lance Yomtob	
Effective Date:	10/30/1981	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BT S/N			

91-19-03	Champion oil filter		No	
Description:	Engine - Continental Motors - LTSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - LTSIO-360-KB	Mechanic name:	Lance Yomtob	
Effective Date:	09/29/1991	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	New FILTER INSTALLED			

92-04-09	Rocker shaft		No	
Description:	Engine - Continental Motors - LTSIO-360-KB	Category:	Engine	
Component:	Engine - Continental Motors - LTSIO-360-KB	Mechanic name:	Lance Yomtob	
Effective Date:	02/18/1992	Certificate #:	AP572868374 IA	
Supersedes:	92-02-20 R1	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BT S/N			

S/N-314346

Right Engine

Page 3

Engine - Continental Motors - LTSIO-360-KB

Subject

Fracture of the crankshaft connecting rod journal

AD #

2000-23-21

Description:

Component:

Effective Date:

Supersedes:

Superseded By:

Compliance:

Notes:

Engine - Continental Motors - LTSIO-360-KB

Engine - Continental Motors - LTSIO-360-KB

12/12/2000

PL2000-08-51

N/A

N/A

To address rapid wear on the face of hydraulic lifters

2009-24-51

Description:

Component:

Effective Date:

Supersedes:

Superseded By:

Compliance:

Notes:

Engine - Continental Motors - LTSIO-360-KB

Engine - Continental Motors - LTSIO-360-KB

Upon Receipt

N/A

2009-24-52

See AD# 2009-24-52

To address rapid wear on the face of hydraulic lifters

2009-24-52

Description:

Component:

Effective Date:

Supersedes:

Superseded By:

Compliance:

Notes:

Engine - Continental Motors - LTSIO-360-KB

Engine - Continental Motors - LTSIO-360-KB

Upon Receipt

2009-24-51

2010-11-04

See AD# 2010-11-04

To prevent excessive hydraulic lifter wear

2010-11-04

Description:

Component:

Effective Date:

Supersedes:

Superseded By:

Compliance:

Notes:

Engine - Continental Motors - LTSIO-360-KB

Engine - Continental Motors - LTSIO-360-KB

06/16/2010

2009-24-52

N/A

N/A

NOT INSTALLED

2012-03-06

Description:

Component:

Effective Date:

Supersedes:

Superseded By:

Compliance:

Notes:

To prevent an in-flight shutdown due to a failed fuel servo diaphragm

Engine - Continental Motors - LTSIO-360-KB

Engine - Continental Motors - LTSIO-360-KB

02/24/2012

2011-15-10

N/A

N/A

PART NOT INSTALLED

Date and Hours
at ComplianceRecurring
Yes/NoNext Due
Date/Hours

No

Category:

Engine

Mechanic name:

Lance Yomtob

Certificate #:

AP572868374 IA

Authorized Sign.:

Yes

Category:

Engine

Mechanic name:

Lance Yomtob

Certificate #:

AP572868374 IA

Authorized Sign.:

Yes

Category:

Engine

Mechanic name:

Lance Yomtob

Certificate #:

AP572868374 IA

Authorized Sign.:

Yes

Category:

Engine

Mechanic name:

Lance Yomtob

Certificate #:

AP572868374 IA

Authorized Sign.:

Yes

Category:

Engine

Mechanic name:

Lance Yomtob

Certificate #:

AP572868374 IA

Authorized Sign.:

N8228J

page 4

Engine-Continental Motors- LTSIO-360-KB S/N:314346 Right Engine

AD#2023-05-16 crankshaft counterweight and
hardware inspection is N/A IAW MSB 23-01A by
date and hours,

Lance Yomtob AP572868374 IA



C/W AD#2023-09-09 V band coupling assembly
when the right tachometer reads 505.6 hours IAW para
(1)(ii)

Lance Yomtob AP572868374 IA



AD Compliance Report

Page 1

S/N-7910881

Right Prop

Propeller - McCauley - 3AF34C503

AD #

2006-14-11

Description:

Component:

Effective Date:

Supersedes:

Superseded By:

Compliance:

Notes:

Subject

Prevent blade failure that could result in separation of a propeller blade

Propeller - McCauley - 3AF34C503

Propeller - McCauley - 3AF34C503

08/17/2005

N/A

N/A

N/A

To detect unsafe conditions that could result in a propeller blade separating from the hub and loss of control of the airplane

Date and Hours
at ComplianceRecurring
Yes/NoNext Due
Date/Hours

No

Category:

Propeller

Mechanic name:

Lance Yonitob

Certificate #:

AP572865374 IA

Authorized Sign.:



2006-24-07

Description:

Component:

Effective Date:

Supersedes:

Superseded By:

Compliance:

Notes:

Propeller - McCauley - 3AF34C503

Propeller - McCauley - 3AF34C503

01/03/2007

N/A

N/A

N/A

N/A

Category:

Propeller

Mechanic name:

Lance Yonitob

Certificate #:

AP572865374 IA

Authorized Sign.:



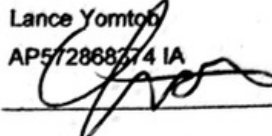
AD Compliance Report

ge 1

S/N-801574

Left Prop

Propeller - McCauley - 3AF34C502

#	Subject	Date and Hours at Compliance	Recurring Yes/No	Next Due Date/Hours
06-14-11	Prevent blade failure that could result in separation of a propeller blade		No	
Category:	Propeller			
Mechanic name:	Lance Yomtoob			
Certificate #:	AP572868374 IA			
Authorized Sign.:				
Component:	Propeller - McCauley - 3AF34C502			
Effective Date:	08/17/2005			
Replaces:	N/A			
Replaced By:	N/A			
Compliance:	N/A			
Notes:	NO WORK DONE BY SO CAL PROP			

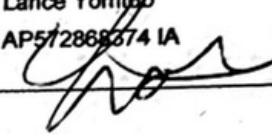
06-24-07 To detect unsafe conditions that could result in a propeller blade separating from the hub and loss of control of the airplane

No

Category: Propeller

Mechanic name: Lance Yomtoob

Certificate #: AP572868374 IA

Authorized Sign.: 

Component: Propeller - McCauley - 3AF34C502

Effective Date: 01/03/2007

Replaces: N/A

Replaced By: N/A

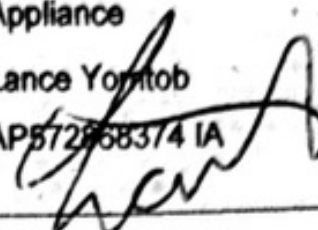
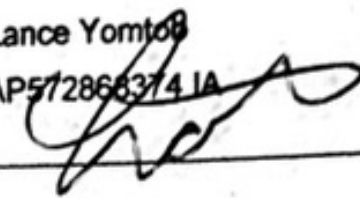
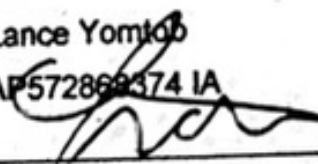
Compliance: N/A

Notes: NO WORK DONE BY OXFORD

AD Compliance Report

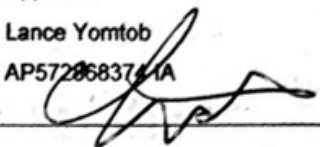
Appliance - Turbochargers - Rajay

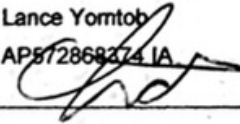
LT + RT

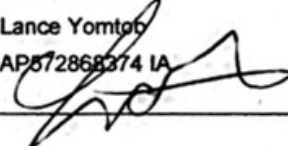
#	Subject	Date and Hours at Compliance	Recurring Yes/No	Next Due Date/Hours
02-03	Rajay turbocharger cracks		Yes	
Description:	Appliance - Turbochargers - Rajay	Category:	Appliance	
Component:	Appliance - Turbochargers - Rajay	Mechanic name:	Lance Yomtov	
Effective Date:	01/10/1965	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BY SWS			
19-04	Rajay hose assemblies		No	
Description:	Appliance - Turbochargers - Rajay	Category:	Appliance	
Component:	Appliance - Turbochargers - Rajay	Mechanic name:	Lance Yomtov	
Effective Date:	09/17/1981	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	new hoses installed BY OH DATE			
2-27-03	Rajay turbochargers	LT = 2438 Hrs 4-07	Yes	LT = 2638 Hrs
Description:	Appliance - Turbochargers - Rajay	Category:	Appliance	
Component:	Appliance - Turbochargers - Rajay	Mechanic name:	Lance Yomtov	
Effective Date:	12/30/1982	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	P/C/W BY INSP			
Notes:				

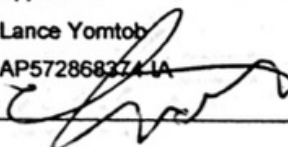
AD Compliance Report

Appliance - Magnetos - TCM (formerly Bendix) S-20 series

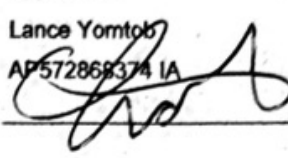
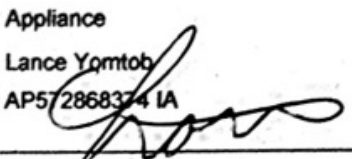
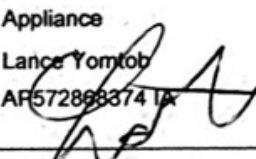
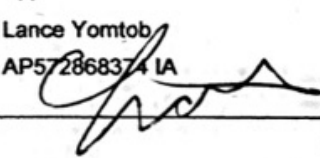
AD #	Subject	Date and Hours at Compliance	Recurring Yes/No	Next Due Date/Hours
73-07-04	Bendix Magnetos		No	
Description:	Appliance - Magnetos - TCM (formerly Bendix) S-20 series	Category:	Appliance	
Component:	Appliance - Magnetos - TCM (formerly Bendix) S-20 series	Mechanic name:	Lance Yomtov	
Effective Date:	10/11/1973	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	94-01-03 R2			
Compliance:				
Notes:	See AD # 94-01-03 R2			

74-26-09	Bendix magnetos		No	
Description:	Appliance - Magnetos - TCM (formerly Bendix) S-20 series	Category:	Appliance	
Component:	Appliance - Magnetos - TCM (formerly Bendix) S-20 series	Mechanic name:	Lance Yomtov	
Effective Date:	12/24/1974	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BY OH DATE			

78-09-07 R3	Bendix magnetos		Yes	
Description:	Appliance - Magnetos - TCM (formerly Bendix) S-20 series	Category:	Appliance	
Component:	Appliance - Magnetos - TCM (formerly Bendix) S-20 series	Mechanic name:	Lance Yomtov	
Effective Date:	01/17/1983	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	96-12-07			
Compliance:				
Notes:	See AD # 96-12-07			

82-20-01	Bendix magnetos		No	
Description:	Appliance - Magnetos - TCM (formerly Bendix) S-20 series	Category:	Appliance	
Component:	Appliance - Magnetos - TCM (formerly Bendix) S-20 series	Mechanic name:	Lance Yomtov	
Effective Date:	06/14/1983	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BY OH DATE See Eng Logs			

Appliance - Magnetos - TCM (formerly Bendix) S-20 series


AD #	Subject	Date and Hours at Compliance	Recurring Yes/No	Next Due Date/Hours
94-01-03 R2	Teledyne/Bendix magnetos		No	
Description:	Appliance - Magnetos - TCM (formerly Bendix) S-20 series	Category:	Appliance	
Component:	Appliance - Magnetos - TCM (formerly Bendix) S-20 series	Mechanic name:	Lance Yomtob	
Effective Date:	06/28/1995	Certificate #:	AP572868374 IA	
Supersedes:	73-07-04	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	P/C/W			
Notes:	AT OH DATES see Eng Logs			
94-06-09	Teledyne/Bendix magnetos		No	
Description:	Appliance - Magnetos - TCM (formerly Bendix) S-20 series	Category:	Appliance	
Component:	Appliance - Magnetos - TCM (formerly Bendix) S-20 series	Mechanic name:	Lance Yomtob	
Effective Date:	05/20/1994	Certificate #:	AP572868374 IA	
Supersedes:	N/A	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	N/A			
Notes:	BY models			
96-12-07	Prevent magneto failure and subsequent engine failure		Yes	
Description:	Appliance - Magnetos - TCM (formerly Bendix) S-20 series	Category:	Appliance	
Component:	Appliance - Magnetos - TCM (formerly Bendix) S-20 series	Mechanic name:	Lance Yomtob	
Effective Date:	07/18/1996	Certificate #:	AP572868374 IA	
Supersedes:	78-09-07 R3	Authorized Sign.:		
Superseded By:	2005-12-06			
Compliance:				
Notes:	see AD# 2005-12-06			
2005-12-06	Prevent failure of the magneto impulse coupling assembly RT-2147		Yes	RT-2647 HWS
Description:	Appliance - Magnetos - TCM (formerly Bendix) S-20 series	Category:	Appliance	
Component:	Appliance - Magnetos - TCM (formerly Bendix) S-20 series	Mechanic name:	Lance Yomtob	
Effective Date:	07/19/2005	Certificate #:	AP572868374 IA	
Supersedes:	96-12-07	Authorized Sign.:		
Superseded By:	N/A			
Compliance:	P/C/W AT OH DATES			
Notes:	see Eng Logs			


AD Compliance Report


Appliance - Heaters - Kelly Aerospace Power Systems


S/N-11791347

P/N-90D38-1
Model # B3040

Subject	Date and Hours at Compliance	Recurring Yes/No	Next Due Date/Hours
7-03 Janitrol combustion heaters		Yes	
Description: Appliance - Heaters - Kelly Aerospace Power Systems	Category:	Appliance	
Component: Appliance - Heaters - Kelly Aerospace Power Systems	Mechanic name:	Lance Yomtov	
Effective Date: 05/06/1982	Certificate #:	AP572868374 1A	
Supersedes: 80-09-10	Authorized Sign.:		
Superseded By: 96-20-07			
Compliance:			
Notes: See AD # 96-20-07			

20-07 Janitrol combustion heaters		Yes	
Description: Appliance - Heaters - Kelly Aerospace Power Systems	Category:	Appliance	
Component: Appliance - Heaters - Kelly Aerospace Power Systems	Mechanic name:	Lance Yomtov	
Effective Date: 11/14/1996	Certificate #:	AP572868374 1A	
Supersedes: 82-07-03	Authorized Sign.:		
Superseded By: 2004-21-05			
Compliance:			
Notes: See AD # 2004-21-05			

001-08-01 Prevent fuel leakage in airplanes		No	
Description: Appliance - Heaters - Kelly Aerospace Power Systems	Category:	Appliance	
Component: Appliance - Heaters - Kelly Aerospace Power Systems	Mechanic name:	Lance Yomtov	
Effective Date: 05/10/2001	Certificate #:	AP572868374 1A	
Supersedes: N/A	Authorized Sign.:		
Superseded By: 2001-17-13			
Compliance:			
Notes: See AD # 2001-17-13			

001-17-13 Potential for fuel leakage in aircraft		Yes	
Description: Appliance - Heaters - Kelly Aerospace Power Systems	Category:	Appliance	
Component: Appliance - Heaters - Kelly Aerospace Power Systems	Mechanic name:	Lance Yomtov	
Effective Date: 09/11/2001	Certificate #:	AP572868374 1A	
Supersedes: 2001-08-01	Authorized Sign.:		
Superseded By: 2004-25-16			
Compliance:			
Notes: See AD # 2004-25-16			

Subject

Date and Hours
at ComplianceRecurring
Yes/NoNext Due
Date/Hours

11-05 Prevent combustion by-products (carbon-monoxide exhaust) and fuel leakage from the combustion heaters

9-2023

Yes

Description: Appliance - Heaters - Kelly Aerospace Power Systems

Category:

Appliance

Component: Appliance - Heaters - Kelly Aerospace Power Systems

Mechanic name:

Lance Yomtob

Effective Date: 11/19/2004

Certificate #:

AP572868374 IA

Revised: 96-20-07

Authorized Sign.:

Revised By: N/A

Compliance: THIS AD IS DUE NOW

Notes: HEATER IS DEACTIVATED

25-16 Prevent failure of the fuel regulator shutoff valve

9-2023

Yes

Description: Appliance - Heaters - Kelly Aerospace Power Systems

Category:

Appliance

Component: Appliance - Heaters - Kelly Aerospace Power Systems

Mechanic name:

Lance Yomtob

Effective Date: 01/05/2005

Certificate #:

AP572868374 IA

Revised: 2001-17-13

Authorized Sign.:

Revised By: N/A

Compliance: THIS AD IS DUE NOW

Notes: HEATER IS DEACTIVATED

-25-16R1 Prevent failure of the fuel regulator shutoff valve

9-2023

Yes

Description: Appliance - Heaters - Kelly Aerospace Power Systems

Category:

Appliance

Component: Appliance - Heaters - Kelly Aerospace Power Systems

Mechanic name:

Lance Yomtob

Effective Date: 06/20/2005

Certificate #:

AP572868374 IA

Revised: N/A

Authorized Sign.:

Revised By: N/A

Compliance: THIS AD IS DUE NOW

Notes: HEATER IS DEACTIVATED